

RECORDED

LAND CORNER RECORDATION CERTIFICATE 1998 JUN 12 AM 8:59
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Dickinson
(County)
City of Norway
1. Public Land Survey

Located In: Corner Code #

T 39NR 29W B-3
T R B-5
T R
T R
S T R
S T R
S T R
S T R

REGISTER OF DEEDS
DICKINSON COUNTY
IRON MOUNTAIN, MI. 49801

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Robert F. Perkins, in a field survey on Feb. 16, 1998 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range may be recorded on this certificate.

ACCEPTED BY THE DICKINSON COUNTY SURVEY PEER GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 345 OF 1990 AT A MEETING HELD ON

6-4-98
CONF

COUNTY REPRESENTATIVE

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3	●				8		9		10		11		12
4	7												
5	●												
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

B-3 North 1/4 Corner, Section 7
James H. Mullett, D.S., Oct. 1849
East Corrected 35.80 Set 1/4 Post
Original Bearing Trees
Maple 3" S61°E 0.23 L.
Maple 6" N60°W 0.10 L.

B-5 South 1/4 Corner, Section 7
James H. Mullett, D.S. 1849
N89°51'E Corrected Set 1/4 Post 35.75 L.
Original Bearing Trees
W.Pine 10" S40°W 0.08 L.
Maple 6" N78°E 0.20 L.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

B-3 No evidence of Original Corner or Accessories Found.
Found 2" Iron Pipe as referred to on Sheet 3-H, City of Norway Land Corner Records (1938). Corner previously Recorded by E. Kazianka, P.S. in 1980 L.C.R.C. No. 271.

B-5 No evidence of Original Corner or Accessories Found.
Found 1" Iron Pipe at ancient Fence intersection. Corner previously Recorded by E. Kazianka, P.S. in 1980. L.C.R.C. No. 272.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

B-3 Accepted Existing 2" Iron Pipe described in B. Cut Pipe off 6" above Ground and Set 2 1/2" D.C. Remon. Stamped Marker inside of Pipe.
New Witnesses:
Oak 30" N44°E (M.B.) 34.85' Nail/Tag
Oak 4" S80°W (M.B.) 38.70' Nail/Tag
Oak 10" S10°E (M.B.) 83.81' Nail/Tag
P.Pole#79-25525 N56°W(M.B.) 51.48' Nail/Tag
Carsonite Marker North 0.70'

B-5 Accepted Existing 1" Iron Pipe described in B. Replaced Pipe with 2 1/2" Stamped D.C. Remon. Marker.
New Witnesses:
Oak 10" S37°W (M.B.) 2.50' Nail/Tag
Oak 16" N85°E (M.B.) 15.20' Nail/Tag
Oak 6" S44°E (M.B.) 40.54' Nail/Tag
Oak 10" S80°W (M.B.) 41.53' Nail/Tag
Carsonite Marker South 0.20'

Signed by Robert F. Perkins
Surveyor's Michigan License No. 12027

Date June 16, 1998

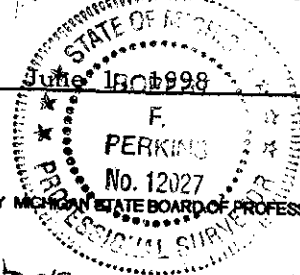

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983
REVISED OCT., 1985

LIBRA 2, PAGE 358