

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF—:	LOCATED IN—:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>40</u> ^{N.} xx , R. <u>28</u> ^{xx} W.	<u>J13</u>
2. PROPERTY CONTROLLING IN SECTION <u>35</u>	T. <u>40</u> ^{N.} xx , R. <u>28</u> ^{xx} W.	<u>#15 & #16</u>
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____, R. _____, S. _____, E. _____	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Arthur O. Enger do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram—over) were, in a field survey on see below 19____, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Corner J13: Wood post Not found.
 Hemlock 8 N45E 14 (Not found. No subsequent accessories found.)
 Hemlock 12 N30W 16 (Not found. No subsequent accessories found.)
 Found a 4"x4"x24" rotted off squared cedar post N75°W 8.8 ft., but have no information on its origin.

Corners 15 & 16: Not established in original survey nor subsequently, apparently.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

Corner J13: Re-established 6/22/73 proportionately on line between section corners 120.213 ch. W and 40.071 ch. E.
Corner 15: This corner falls in the Sturgeon River; on 6/28/73 established a meander corner on W. bank of river S89°06'W 1.30 ch. from one-sixteenth corner position. Monument stamped "N89-06E 1.30 Ch. To West 1/16 Cor. $\frac{35}{2}$ "
Corner 16: Established 6/22/73 on line between section corner 20.035 ch. E and 1/4 corner 20.035 ch. W. Corner falls in a pasture, formerly cultivated land belonging to a farm.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Monuments for all three corners: 1" I.D. x 36" iron pipe with 4" aluminum cap.
Witnesses for Corner J13: Sugar Maple 9 N38°W (mag.) 9.9 ft. "1/4S, NBT"
Sugar Maple 5 S47°E (mag.) 15.4 ft. "1/4S, NBT"
Distances horizontal.
Witnesses for Corner 15: B. Ash 12 S54°E (mag.) 9.5 ft. "M.C., BT"
R. Maple 8 N65°W (mag.) 15.0 ft. "M.C., BT"
Also squared and scribed a B. Ash 3.2 ft. E of pipe. Note: Above witnesses are to the M.C., not to the one-sixteenth corner.
Witnesses for Corner 16: Sugar Maple 4 N28°W (mag.) 111.5 ft. "1/16S, BT"
Sugar Maple 6 N61°E (mag.) 141.0 ft. "1/16S, BT"

SIGNED BY _____ DATE _____


SURVEYOR'S MICHIGAN REGISTRATION NO. _____ (SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY Arthur O. Enger DATE January 31, 1974

Arthur O. Enger
 Michigan Registered Land Surveyor
 Michigan Department of Natural Resources

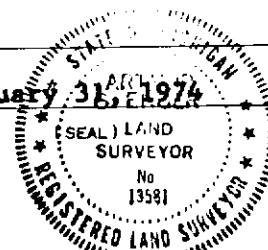

SURVEYOR'S MICHIGAN REGISTRATION NO. 13581