

9.

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Dickinson
 (County)

Located In:

Corner Code ##

- | | | | | | |
|---------------------------------------|---|------------|---|------------|------------|
| 1. Public Land Survey | T | <u>41N</u> | R | <u>27W</u> | <u>All</u> |
| | T | | R | | |
| | T | | R | | |
| | T | | R | | |
| 2. Property Controlling
In Section | S | | T | R | |
| | S | | T | R | |
| 3. Miscellaneous
Property in Sec. | S | | T | R | |
| | S | | T | R | |

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	16	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Stephan J. Szyszkoski, in a field survey on May 04, 1993, 19_____, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

(All) Section corner common to Sections 30-31, T41N-R27W and Sections 35-36, T41N-R28W. Corner previously recorded by Henry S. Peterson in 1962 as restored from new bearing trees placed by Billy D. Duckler in 1959. 1962 record states: 1" pipe with 4" brass cap. Hard Maple 5" N21E 45.5 links marked X NBT, Hard Maple 4" N19W 53.5 links marked X NBT, Aspen 8" S04W 39 links marked S36 NBT. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


(All) 1962 corner monument was not recovered. Restored the corner at record bearing and distance from the 1962 NBTs as follows: Hard Maple N21E found in good condition, Hard Maple N19W has been cut down, Aspen S04W is dead but standing. At the position for the corner I placed a 1" I.D.x32" iron pipe projecting 12" and capped with a yellow plastic cap stamped D.W.R. LS 33986. Marked 3 new bearing trees as described below.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(All) Set 1" pipe with plastic cap.
 Blazed and scribed the following new bearing trees:

16" Aspen S21W 8.1' "S36 NBT"
 4" Sugar S71E 24.6' "S31 NBT"
 4" Sugar N21E 49.2' "S30 NBT"

Corner lies at the south side of a road.

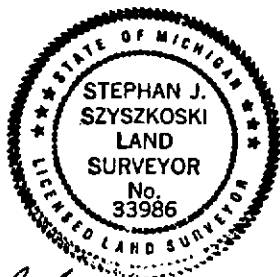

Signed by

Stephan J. Szyszkoski

Date

9-16-93

Surveyor's Michigan License No.

33986