

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Dickinson</u>	Located in:	Corner Code #
(County)		
1. Public Land Survey	T41N R 29W	M10
	T R	
	T R	
	T R	
2. Property Controlling in Section	S25 T41N R 29W	6
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

6 Oct 28 1998
 M10 Sep 10 1998

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	10		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:
 (M10) Quarter corner common to Section 25 T41N-R29W and Section 30 T41N-R28W. Corner reestablished in 1960 by Billy D. Buckler: "This corner was reestablished by setting it on line and midway between section corners. No evidence of original corners. Corner was placed and witnessed June 3, 1960 with Frank J. Bray. Description of corner monument: 1" iron pipe with 4" brass cap. Witnesses: 10" Cedar N55W 73 links, 8" Cedar S05E 28 links."

(6-Sec. 25) Northeast 1/16 corner, Section 25. Corner not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


(M10) Recovered the 1960 monument as described, a 1" ID iron pipe capped with a 4" dia. brass Michigan Dept. of Conservation tablet, in good condition, and at record bearing and distance from the 1960 NBT's both in good condition with overgrown blazes. Measuring nails, placed subsequently, were found in both of these trees, as well as in two additional NBT's which were found marked. Verified the position of the monument as being 2639.08' South of and 2629.39' North of adjacent Section corners, and being 0.3' West of a line between them. I accept the monument as a careful and faithful reestablishment of the position of the original corner. I left it in place and made measurements to the existing witness trees. Corner recovered and re-witnessed by D.Lampela and B.Wheeler, Baraga District Office.

(6-Sec. 25) Found no evidence of prior monumentation at the corner position. Established the corner at the intersection of straight lines connecting opposite 1/16 corners. At the position for the corner I placed a 1" ID x 32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Corner placed and witnessed by D.Lampela and B.Wheeler, Baraga District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(M10) Found 1" pipe with 4" brass cap.
 Found nails in side blazes in the following:
 16" Cedar N49W 48.1' with old blaze
 15" Cedar S04E 15.4' do
 10" Sugar S85W 43.8' w/ blazes and nail
 6" B. Ash N52E 24.6' do
 Bearings are magnetic. Distances are to the measuring nails.

(6) Set 1" pipe with 4" MDNR cap.
 Blazed and scribed the following:
 8" Maple S78W 19.7' "1/16S BT"
 9" Maple N17W 56.1' do
 5" twin B.Ash N43E 14.8' do
 11" Maple S81E 34.3' do
 Placed a squared cedar post adjacent.
 Bearings are magnetic. Distances are to notch in lower blaze.

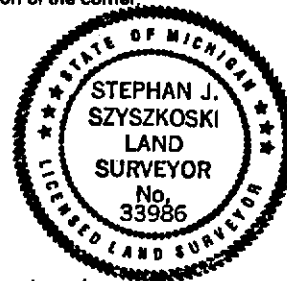

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 3/30/99

For the Michigan Department of Natural Resources - Forest Management Division