

**LAND CORNER RECORDATION CERTIFICATE**  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Dickinson

(County)

Located In:

Corner Code #

1. Public Land Survey	T41N	R 29W	19
	T	R	
	T	R	
	T	R	
2. Property Controlling in Section	S26	T41N	R 29W
	S	T	R
3. Miscellaneous Property in Sec.	S	T	R
	S	T	R

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

1 Oct 20 1998  
19 Jun 09 1998

I, Stephan J. Szyszkoski, in a field survey on \_\_\_\_\_, 19\_\_\_\_ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	16	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:  
(19) Corner common to Sections 22-23-26-27. Established in 1849 by John Burt: "North between Sections 26 & 27...80.00 Set Cedar post corner of Sections 22-23-26-27. Cedar 12 N21E 16, Cedar 14 S37W 35."  
(1-Sec. 26) West 1/16 corner between Sections 23-26. Corner not established in the original survey. Found no subsequent record.


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(19) The original post was not recovered. Reestablished the corner at the probable original location as determined by the recovery of the stump remains of two cedars, of proper size, both at record bearing and distance. A reestablished corner is 79.7193 chains southerly, an original corner 39.8778 chains easterly (40.0 R). Also ridge call to the north checks with the original record as does a ridge call to the west (within 1/2 chain). At the position for the corner, I placed a 1" ID x 32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped.

(1-Sec. 26) Found no evidence of prior monumentation at the corner position. Established the corner midway and on a line of mean true bearing between Section corner 1315.97' west and Quarter corner 1315.97' east. At the position for the corner I placed a 1" ID x 32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped, set firm in a mound of rock 2.5' wide by 3' long by 2' high. Corner placed and witnessed by D.Lampela and B.Wheeler, Baraga District Office. From the corner monumented, I found a squared maple post N09E 10.25'.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(19) Set 1" iron pipe with 4" MDNR cap. Blazed and scribed the following: 6" Ash N43W 10.5' "S22 NBT" 13" Maple N62E 41.9' "S23 NBT" 6" Ash S48E 21.9' "S26 NBT" 7" Ash S31W 12.6' "S27 NBT" Placed tag on 6" Squared Ash S53W 5'. Bearings are magnetic. Distances are to notch in lower blaze.	(1) Set 1" pipe with 4" MDNR cap. Blazed and scribed the following: 7" Oak S22E 14.6' "1/16S BT" 6" N. Pine N72W 21.75' do 9" Oak N40W 48.25' do 7" Oak N06E 51.8' do Bearings are magnetic. Distances are to notch in lower blaze.
---	---

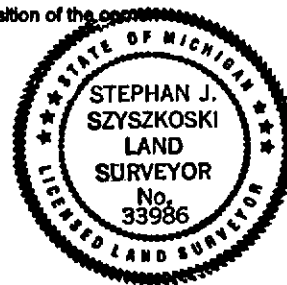

Signed by Stephan J. Szyszkoski  
Surveyor's Michigan License No. 33986

Date 3/30/99

For the Michigan Department of Natural Resources - Forest Management Division