

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Dickinson

(County)

Located in:

Corner Code #

1. Public Land Survey	T <u>41</u> N	R <u>29</u> W	H11
	T	R	
	T	R	
	T	R	
2. Property Controlling in Section	S <u>26</u>	T <u>41</u> N	R <u>29</u> W
	S	T	R
3. Miscellaneous Property in Sec.	S	T	R
	S	T	R

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

4 Oct 20 1998
H11 Oct 15 1998

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5												
6	18		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												


A. Description of original monument and accessories and/or subsequent restoration:
(H11) Quarter corner common to Sections 27-34. Established in 1849 by John Burt: "West Corrected [between Sects. 27 & 34]...40.07 Set Cedar Qr. Section post. Cedar 10 N19E 23, Cedar 10 S35W 10."
(4-Sec. 26) Northwest 1/16 corner Section 26. Corner not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(H11) Original post and accessories were not recovered. Found no acceptable evidence of the position of the original corner on the ground. Reestablished the corner midway and on a line of mean true bearing between monumented section corners 2632.71' east and west. At the position for the corner I placed a 1" ID x 32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Corner placed and witnessed by B.Wheeler and D.Lampela, Baraga District Office.
(4-Sec. 26) Found no evidence of prior monumentation at the corner position. Established the corner at the intersection of straight lines connecting opposite 1/16 corners. At the position for the corner I placed a 1" ID x 32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Corner placed and witnessed by B.Wheeler and D.Lampela, Baraga District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(H11) Set 1" pipe with 4" MDNR cap.	(4) Set 1" pipe with 4" MDNR cap.
Blazed and scribed the following:	Blazed and scribed the following:
22" R. Pine N71E 44.3' 1/4S MBT"	6" B. Ash S19E 3.2' 1/16S BT"
4" Sugar N78E 38.3' do	8" B. Ash N83E 21.15' do
17" N. Pine S03W 58.9' do	4" B. Ash N16N 23.6' do
7" Cedar S50W 89.9' do	7" B. Ash S83W 11.8' do
Placed a squared cedar post adjacent.	Placed a squared cedar post adjacent.
Bearings are magnetic. Distances are to notch in lower blaze.	Bearings are magnetic. Distances are to notch in lower blaze.

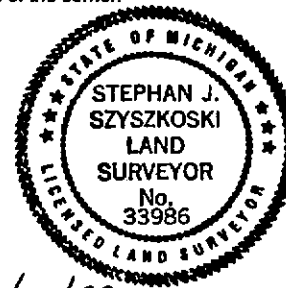

Signed by Stephan J. Szyszkoski
Surveyor's Michigan License No. 33986

Date 3/30/99

For the Michigan Department of Natural Resources - Forest Management Division