

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Dickinson

(County)

Located in:

Corner Code #

1. Public Land Survey	T11N R 29W	I12
	T R	
	T R	
	T R	
2. Property Controlling in Section	S35 T11N R 29W	9
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

9 Sep 28 1998
I12 Oct 17 1998

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.


	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	10		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34	●	35	●	36		
13													

A. Description of original monument and accessories and/or subsequent restoration:
(I12) Quarter corner common to Sections 34-35. Established in 1849 by John Burt: "North between Sections 34 & 35...40.00 Set Cedar Cr. Section post. Hemlock 12 N30W 13, do 16 S13E 9."
(9-Sec. 35) East 1/16 corner, Section 35. Corner not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(I12) Original post and accessories were not recovered. Found no acceptable evidence of the position of the original corner on the ground. Reestablished the corner midway and on a line of mean true bearing between monumented Section corners 2630.65' north and south. At the position for the corner I placed a 1" IDx32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Corner placed and witnessed by B.Wheeler and D.Lampela, Baraga District Office.
(9-Sec. 35) Found no evidence of prior monumentation at the corner position. Established the corner midway and on a straight line between Center of Section and Quarter corner 1318.38' West and East. At the position for the corner I placed a 1" ID x 32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Corner placed and witnessed by D.Lampela and B.Wheeler, Baraga District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
(I12) Set 1" pipe with 4" MDNR cap. Blazed and scribed the following:
5" Spruce S80E 28.9' 1/4S NBT
2" Spruce N12E 24.1' do
3" Maple S13W 28.0'(slope dist.) do
4" Balsam S79W 9.55' do do
Placed a squared cedar post adjacent. Bearings are magnetic. Distances to notch in lower blaze.
(9) Set 1" pipe with 4" MDNR cap. Blazed and scribed the following:
9" Sugar N42E 18.7' 1/16S BT
7" Sugar N44W 10.4' do
6" Sugar S29W 8.65' do
10" Ash S86E 44.2' do
Placed a squared cedar post adjacent. Bearings are magnetic. Distances to notch in lower blaze.

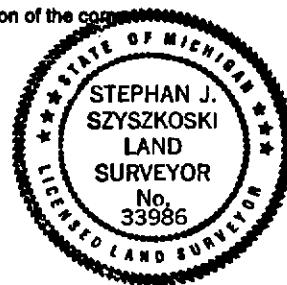

Signed by

Stephan J. Szyszkoski

Surveyor's Michigan License No.

33986

Date

3/30/99

For the Michigan Department of Natural Resources - Forest Management Division