

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Dickinson</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
2. Property Controlling in Section	S35 T41N R29W	6
	S35 T41N R29W	7
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

7 Sep 15 1998
 6 Sep 28 1998

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	10		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:


(6-Sec. 35) Northeast 1/16 corner, Section 35. Corner not established in the original survey. Found no subsequent record.
 (7-Sec. 35) North 1/16 corner between Sections 35-36. Corner not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(6-Sec. 35) Found no evidence of prior monumentation at the corner position. Established the corner at the intersection of straight lines connecting opposite 1/16 corners. At the position for the corner I placed a 1" IDx32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Corner placed and witnessed by D.Lampela and B.Wheeler, Baraga District Office.
 (7-Sec. 35) Found no evidence of prior monumentation at the corner position. Established the corner midway and on a line of mean true bearing between Section corner 1310.03' north and quarter corner 1310.03' south. At the position for the corner I placed a 1" IDx32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Corner placed and witnessed by B.Wheeler and D.Lampela, Baraga District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(6) Set 1" pipe with 4" MDNR cap. Blazed and scribed the following: 11" Cedar S83E 45.8' "1/16S BT" 11" Cedar S32E 50.65' do 12" Hemlock S07W 38.2' do 12" Cedar North 38.5' do Placed a squared cedar post adjacent. Bearings are magnetic. Distances are to notch in lower blaze.	(7) Set 1" pipe with 4" MDNR cap. Blazed and scribed the following: 4" Sugar N13E 13.3' "1/16S BT" 7" B. Ash S47E 35.1' do 7" Maple S64W 43.8' do 7" Spruce N44W 42.5' do Placed a squared cedar post adjacent. Bearings are magnetic. Distances are to notch in lower blaze.
--	--

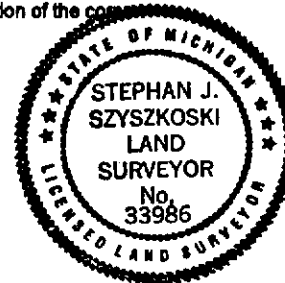

Signed by Stephan J. Szyszkoski Date 3/30/99
 Surveyor's Michigan License No. 33986

For the Michigan Department of Natural Resources - Forest Management Division