

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Dickinson

 (County)

Located in:

Corner Code #

1. Public Land Survey

T 41N R 29W E8
 T _____ R _____
 T _____ R _____
 T _____ R _____

2. Property Controlling in Section

S _____ T _____ R _____
 S _____ T _____ R _____

3. Miscellaneous Property in Sec.

S _____ T _____ R _____
 S _____ T _____ R _____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Apr 26 2001

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5												
6	18		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												


A. Description of original monument and accessories and/or subsequent restoration:
 (E8) Quarter corner common to Sections 20-21. Established in 1849 by John Burt: North between Sections 20 & 21...40.00 Set spruce Cr. Sect. post. Tamarack 6 S26E 63, Tamarack 6 N52W 36. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(E8) The original post and accessories were not recovered. Found no acceptable evidence of the position of the original corner on the ground. Reestablished the corner midway and on a line of mean true bearing between Section corners 2635.44' north and south.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(E8) Set 1 1Dx32" iron pipe with 4" alum. MDNR cap. Blazed and scribed:
 7" B. Spruce N61E 15.3' "1/4S N8T"
 6" B. Spruce S27E 15.1' do
 5" Tamarack S18W 18.0' do
 4" Tamarack N50W 6.6' do
 Set a sq'd cedar post adjacent.
 Bearings are magnetic. Distances to notch in lower blaze.

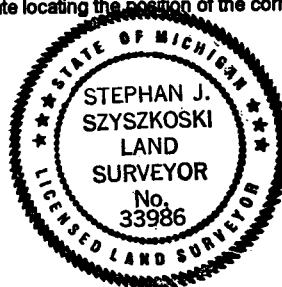

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 5/23/01

For the Michigan Department of Natural Resources - Forest Management Division