

26.

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Dickinson
 (County)

	Located In:	Corner Code #/
1. Public Land Survey	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
2. Property Controlling in Section	S <u>1</u> T <u>41N</u> R <u>30W</u>	<u>8</u>
	S <u>1</u> T <u>41N</u> R <u>30W</u>	<u>4</u>
3. Miscellaneous Property in Sec.	S <u>1</u> T <u>41N</u> R <u>30W</u>	<u>5</u>
	S ___ T ___ R ___	_____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	13	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Stephan J. Szyszkoski, in a field survey on December 03, 1992, 19____, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below.


NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- (8) West 1/16 corner Section 1 T41N-R30W. Corner not established in the original survey. Found no subsequent record.
 (4) Northwest 1/16 corner, Section 1, T41N-R30W. Corner not established in the original survey. Found no subsequent record.
 (5) North 1/16 corner, Section 1 T41N-R30W. Corner not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner.

- (8) Found no evidence of monumentation at corner position. Established the corner midway and on a straight line between the monumented quarter corner to Sections 1-2 and the computed Center of Section 1, in accordance with BLM instructions for the subdivision of regular sections.
 (4) Found no evidence of monumentation at corner position. Established the corner at the intersection of opposite 1/16 corners, all monumented and recorded as of this date.
 (5) Found no evidence of monumentation at this position. Established the corner 20 chains, proportionate measure, north of the computed Center of Section 1, on a line between said Center and the monumented North 1/4 corner of Section 1. The center of Section 1 was determined by the intersection of straight lines connecting opposite 1/4 corners.

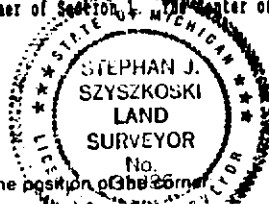

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner.

- | | | |
|--|--|---|
| (8) Placed a 1"x32" iron pipe capped with a 4" dia. cast aluminum MDRR tablet. Blazed and scribed the following new bearing trees:
5" Sugar S77E 2.0' (1/16S BT)
6" Sugar N20E 22.6' (1/16S BT)
6" Sugar N56W 6.1' (1/16S BT)
4" Sugar S07W 6.5' (1/16S BT)
West 0.5' 2" Sugar stake. | (4) Placed a 1"x32" iron pipe capped with a 4" dia. cast aluminum MDRR tablet. Blazed and scribed the following new bearing trees:
20" Cedar N72W 25.9' (1/16S BT)
11" Ash S13W 5.7' (1/16S BT)
7" Ash N81E 6.7' (1/16S BT)
7" Ash N09E 21.8' (1/16S BT)
South 0.7' placed squared 3" ash post. | (5) Placed a 1"x32" iron pipe capped with a 4" dia. cast aluminum MDRR tablet. Blazed and scribed the following new bearing trees:
12" W. Birch S75E 2.4' (1/16S BT)
7" Sugar N69E 18.9' (1/16S BT)
10" Sugar S43W 15.7' (1/16S BT)
5" Sugar N52W 17.1' (1/16S BT)
S45E 2.4' squared a 5" sugar. |
|--|--|---|

Signed by Stephan J. Szyszkoski

Date 1-12-93

Surveyor's Michigan License No. 33986