

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Dickinson

(County)

Located In:

Corner Code #

- | | | | |
|------------------------------------|------|-------------|-------|
| 1. Public Land Survey | T | R | _____ |
| | T | R | _____ |
| | T | R | _____ |
| | T | R | _____ |
| 2. Property Controlling in Section | S 23 | T 41N R 30W | 5 |
| | S 23 | T 41N R 30W | 6 |
| 3. Miscellaneous Property in Sec. | S | T | R |
| | S | T | R |

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Jun 26 2000

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	10	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:


- (5-Sec. 23) North 1/16 corner, Section 23. Corner not established in the original survey. Found no subsequent record.
 (6-Sec. 23) Northeast 1/16 corner, Section 23. Corner not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- (5-Sec. 23) Established the corner midway and on a straight line between 1/4 corner to north and Center of Section to south.
 (6-Sec. 23) Established the corner at the intersection of straight lines connecting opposite 1/16 corners. At the position for the corner I placed a 1" ID x 32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- | | |
|---|---|
| (5) Set 1" pipe with 4" aluminum MDNR cap. Blazed and scribed: | (6) Set 1" pipe with 4" MDNR cap. Blazed and scribed the following: |
| 5" dbl. Maple N04E 34.7' "1/16S BT" | 4" Maple N42E 26.1' "1/16S BT" |
| 7" Bl. Ash N58E 34.5' do | 5" Maple S47E 33.7' do |
| 4" Cedar S14W 4.9' do | 6" Maple S62W 45.5' do |
| 9" Spruce N81W 51.4' do | 5" Maple North 17.0' do |
| Sq'd cedar post adjacent. Bearings are magnetic. Distances to notch in lower blaze. | Sq'd maple post adjacent. Bearings are magnetic. Distances to notch in lower blaze. |

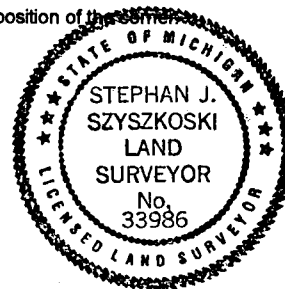

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 8/22/00

For the Michigan Department of Natural Resources - Forest Management Division