

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in  
Dickinson

(County)

Located In:

Corner Code #

1. Public Land Survey

T R  
T R  
T R  
T R

2. Property Controlling  
In Section

S 24 T 42N R 28W 12

3. Miscellaneous  
Property in Sec.

S T R  
S T R



4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

Jun 17 1997

I, Stephan J. Szyszkoski, in a field survey on \_\_\_\_\_, 19\_\_\_\_ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												


A. Description of original monument and accessories and/or subsequent restoration:  
(12-Sec. 24) South 1/16 corner, Section 24. Corner established in 1978 by A.O. Enger, RLS: "Established on line between S 1/4 cor. 20.0215 ch. S and Center 1/4 20.0215 ch. N. Corner monument: 1"x36" iron pipe with 3 3/4" aluminum cap. Witnesses to corner: Cedar 18 N46W 24.7', Cedar S 578W 18.8".

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(12-Sec. 24) Found the 1978 monument, as described, N82W 30.2' distant from the 1978 corner position. The monument was likely moved to this erroneous location by an adjacent land owner as the position at which it was found alleviates a cabin encroachment. Both 1978 bearing trees were recovered. The Cedar NW is in good condition with scribing visible, the Cedar SW is a 1 1/2' tall stump with scribing visible. At the 1978 position for the corner, at record bearing and distance from the recorded BTs, I placed a 1"x32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped, set 4" below the surface at the E. edge of a two-track trail. No measurements were made to other corners at this time. Corner monumented by B. Wheeler and D. Lampela, Baraga District Office, MDNR. The 1978 monument found at the improper position was removed.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner.

(12) Set 1" pipe with 4" MDNR cap.  
Blazed and scribed the following:  
8" Cedar N60E 11.3' "1/16S BT"  
7" Cedar S21E 22.2' "1/16S BT"  
8" Cedar S62W 21.7' "1/16S BT"  
The 1978 witness: 18" Cedar N43W 24.7'  
Bearings are magnetic.

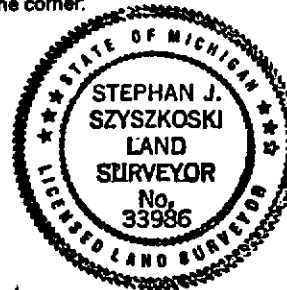

Signed by Stephan J. Szyszkoski  
Surveyor's Michigan License No. 33986

Date 9/2/97

For the Michigan Department of Natural Resources - Forest Management Division