

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Dickinson</u>	Located In:	Corner Code #
(County)		
1. Public Land Survey	T <u>43N</u> R <u>27W</u>	<u>C7</u>
	T <u> </u> R <u> </u>	<u> </u>
	T <u> </u> R <u> </u>	<u> </u>
	T <u> </u> R <u> </u>	<u> </u>
2. Property Controlling in Section	S <u>18</u> T <u>43N</u> R <u>27W</u>	<u>16</u>
	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
3. Miscellaneous Property in Sec.	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
	S <u> </u> T <u> </u> R <u> </u>	<u> </u>

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Jun 15 1999

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

A. Description of original monument and accessories and/or subsequent restoration:
 (C7) Corner common to Sections 17-18-19-20. Original corner established in 1850 by John Burt: "N89 52'W corrected...80.00 set cedar post corner of Secs. 17,18,19, & 20. Cedar 16 S53E 20, Cedar 16 N16W 39". Found no subsequent record.
 (16-Sec. 18) East 1/16 corner between Sections 18-19. Corner not established in the original survey. Found no subsequent record.


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(C7) Original post and accessories were not recovered. Found no acceptable evidence of the position of the original corner on the ground. Reestablished the corner by double proportionate measurement to the original record between corners 1 mile west, 1 mile east, 1 mile north, and 1/2 mile south. At the position for the corner, I placed a 1" ID x 32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped.

(16-Sec. 18) Established the corner on a line of mean true bearing between Quarter corner 1322.75' Westerly and Section corner 1322.75' Easterly. At the position for the corner I placed a 1" IDx32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped, and buried beneath the surface of the trail road in which it falls.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(C7) Set 1" pipe with 4" MDNR cap. Blazed and scribed the following: 8" Aspen N65E 23.0' "S17 NBT" 10" Spruce S47E 83.45' "S20 NBT" 5" Spruce S10W 74.9' "S19 NBT" 17" Spruce N40W 104.1' "S18 NBT" Placed squared cedar post adjacent. Bearings are magnetic. Distances are to notch in lower blaze.	(16) Set 1" pipe with 4" MDNR cap. Blazed and scribed the following: 6" Spruce N07E 61.7' "1/16S 8T" 17" Spruce S34E 84.35' do 6" Spruce S46W 65.0' do 9" Aspen N57W 52.8' do Squared cedar post with location poster N64E 6.0'. Bearings are magnetic. Distances are to notch in lower blaze.
--	--

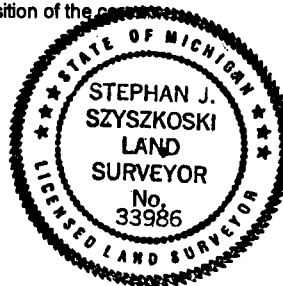

Signed by Stephan J. Szyszkoski Date 2/7/00
 Surveyor's Michigan License No. 33986

For the Michigan Department of Natural Resources - Forest Management Division