

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Dickinson
 (County)

Located In:

Corner Code #

1. Public Land Survey

T 43N R 27W 01
 T 43N R 27W 81
 T R
 T R

2. Property Controlling in Section

S T R
 S T R

3. Miscellaneous Property in Sec.

S T R
 S T R

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Jul 20 2000

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5												
6	18		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												

A. Description of original monument and accessories and/or subsequent restoration:


- (D1) Quarter corner common to Section 5 T43N-R27W and Section 32 T44N-R27W. Corner reestablished in 1961 by Billy D. Buckler, RLS, using proportionate methods. 1" Iron pipe with 4" brass cap. 10" Balsam S24W 16 links, 10" Aspen S54E 23 links.
- (B1) Quarter corner common to Section 6 T43N-R27W and Section 31 T44N-R27W. Reestablished in 1961 by Billy D. Buckler, RLS, using proportionate methods. 1" iron pipe with 4" aluminum cap. 2' Rock S41W 16 links, 2' Rock N53E 45 links, 3' Rock S22E 40 links.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- (D1) Recovered the 1961 monument, a 1" ID iron pipe capped with a 4" brass Michigan Dept. of Conservation tablet, in good condition and at record bearing and distance from the stump remains of the two 1961 NBTs, which had been cut down years ago. Left the monument in place and made new witnesses.
- (B1) Recovered the 1961 monument, a 1" ID iron pipe capped with a 4" dia. aluminum Michigan Dept. of Conservation tablet, in good condition and at record bearing and distance from the record accessories. Left the monument in place and made additional witnesses.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- | | | | |
|---|------------|--|------------|
| (D1) Found 1" ID iron pipe with 4" brass cap. Blazed and scribed: | | (B1) Found 1" ID iron pipe with alum. cap. Blazed and scribed: | |
| 9" Spruce N05W 100.95' | "1/4S NBT" | 9" Balsam N35E 43.0' | "1/4S NBT" |
| 9" Spruce N11E 88.70' | do | 8" Spruce N86E 91.1' | do |
| 14" Spruce N32E 117.95' | do | 7" Balsam East 2.2' | do |
| 14" Spruce N46E 118.55' | do | 11" Balsam S35W 23.15' | do |
- Bearings are magnetic. Distances are to notch in lower blaze.
- Sq'd cedar post adjacent. Bearings are magnetic. Distances are to notch in lower blaze.

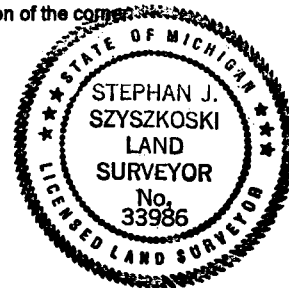

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 5/2/01

For the Michigan Department of Natural Resources - Forest Management Division