## LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in Dickinson	Located in:	Com	er Code #		
(County)	<u> </u>				
1. Public Land Survey	T_43HF		H1		
Property Controlling     in Section     Miscellaneous	S2 T3NF S TF S T F	2 <u>8</u> N	1		

Register of Deeds Stamp & File Number


4. Lot No	, Recorded Plat				
5. Private Claims		-			
			A 21 100	•	

Property in Sec.

Apr 21 1998 Apr 16 1998

Stephan J. Szyszkoski , in a field survey on 19 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current menual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumerised, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

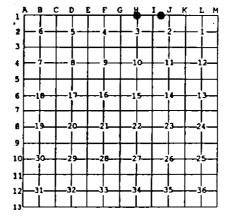

Description of original monument and accessories and/or subsequent restoration:

(H1) Quarter corner common to Section 3, 143M-R28M and Section 34, 144M-R28M. Feb. 2, 1972 record by A.O.Enger states "October 29, 1970: Corner reestablished by proportionate measurement on line between original section corners 1.5 miles east and 3.5 miles west. Corner manument 1°I.D.x36° iron pipe with 4° aluminum cap. Witnesses to corner, Elm 8 M23W 11.9', Balsam 6 M23E 24.1''. (1-Sec. 2) West 1/16 corner between Section 2 743N-R28W and Section 35 744N-R28W. February 1, 1972 record by A.O. Enger states October 21, 1969: Corner established 60.00 ch. west of original section corner 1,2,35, and 36, T43-44M, R28M on line between that corner and the original township corner of T43-44M, R28-29M. Corner lies 4.67 ch. west of a swamp edge noted in original field notes as being 5.00 ch. east of this corner. Corner is in a large upland clearing. Ho evidence that the corner had been established previously. Corner monument 1"I.D.x36" iron pipe with 4" aluminum cap. No trees available for witnesses".

## B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(H1) Recovered the 1970 monument as described and in good condition. Determined that the 1970 Enger survey was erroneous as the result of a measurement error made between E1 and K1. I rejected the monument as representing the position of the corner and I reestablished the corner by single proportionate measurement to the original record between section corners 2643.40' East and West from which the 1970 monument was found 13.8' westerly. I removed the 1970 monument and placed it at the position for the corner. Corner placed and mitnessed by 8.Wheeler and D.Lampela. Baraga District Office.

(1-Sec. 2) Recovered the 1969 monument as described and in good condition. Determined that the 1969 Enger survey was erroneous as the result of a measurement error made between El and Kl. I rejected the monument as representing the position of the corner and I reestablished the corner midway and on a line of mean true bearing between Section corner 1321.70' Mest and Quarter corner 1321.70' East, from which the 1969 monument was found Easterly 8.0 feet. I removed the 1969 monument and placed it at the position for the corner. Corner placed and witnessed by D.Lampela and B.Nheeler, Baraga District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner.

(H1) Set 1 pipe with 4 aluainum (1-Sec. 2) 1 iron pipe capped with 4 (HI) Set I pipe with 4 aluminum Michigan Dept. of Conservation cap. aluminum Michigan Dept. of Conservation Blazed and scribed the following: tablet. Blazed and scribed the "1/45 NBT" following new bearing trees: 8 Y. Birch SO4E 61.5' B" Y. Birch S43W 44.15 "1/4S NBT" 15" Maple NS7E 164.4" "1/165 BT" 14" Balsam N77W 70.1" "1/45 MBT" 5" Spruce \$45E 112.0" "1/16S BT" 14" Balsam NOBW 23.0" "1/4S NBT" 5" Spruce \$62W 39.5" "1/16S BT" 6" Maple N17W 173.4" "1/16S BT" Placed a squared cedar post adjacent. Bearings are magnetic. Bearings are magnetic.

STEPHAN J SZYSZKOSKI LAND SURVEYOR

33986 Surveyor's Michigan License No.

For the Michigan Department of Matural Resources - Forest Management Division