

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Dickinson

 (County)

Located in:

Corner Code #

1. Public Land Survey

T ___ R ___
 T ___ R ___
 T ___ R ___
 T ___ R ___

2. Property Controlling
in Section

S 2 T 43N R 28W 2
 S ___ T ___ R ___

3. Miscellaneous
Property in Sec.

S ___ T ___ R ___
 S ___ T ___ R ___

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

Apr 15 1998

I, Stephan J. Szyszkoski, in a field survey on _____, 19__ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2								
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:
 (2-Sec. 2) East 1/16 corner between Section 2 T43N-R28W and Section 35 T44N-R28W. February 3, 1972 record by A.O. Enger states "October 22, 1969: Corner established on line between section corner 20.00 ch. east and 1/4 corner 20.00 ch. west. Corner monument 1" 1.0"x36" iron pipe with 4" aluminum cap. Witnesses to corner: B.Spruce 4 N71 1/2E 17.5 links, B.Spruce 5 N02E 37.5 links".

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


(2-Sec. 2) Recovered the 1969 monument as described and in good condition. Determined that the 1969 Enger survey was erroneous as the result of a measurement error made between E1 and K1. I rejected the monument as representing the position of the corner and I reestablished the corner midway and on a line of mean true bearing between the 1/4 corner 1321.70' West and Section corner 1321.70' East, from which the 1969 monument was found Easterly, 2.4'. I removed the 1969 monument and placed it at the position for the corner. Corner placed and witnessed by D.Lampela and B.Wheeler, Baraga District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(2-Sec. 2) 1" 10 iron pipe capped with a 4" aluminum Michigan Dept. of Conservation tablet. Blazed and scribed the following:

B. Spruce N12E 25.1' "1/16S BT"
 5" Tamarack N39E 5.0' "1/16S BT"
 5" Tamarack S25E 4.3' "1/16S BT"
 4" Tamarack N80W 15.0' "1/16S BT"

Placed a squared tamarack post adjacent. Bearings are magnetic.

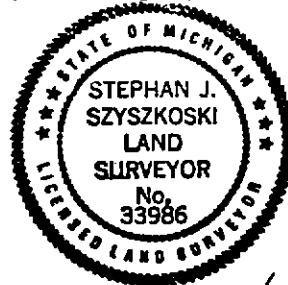

Signed by

Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date

6/25/98

For the Michigan Department of Natural Resources - Forest Management Division