

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

Dickinson  
 (County)

Located In: Corner Code #

1. Public Land Survey	T <u>43N</u> R <u>28W</u>	<u>K10</u>
	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
2. Property Controlling in Section	S <u>27</u> T <u>43N</u> R <u>28W</u>	<u>2</u>
	S ___ T ___ R ___	_____
3. Miscellaneous	S ___ T ___ R ___	_____
Property in Sec.	S ___ T ___ R ___	_____

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

Jun 13 2001

I, Stephan J. Szyszkoski, in a field survey on \_\_\_\_\_, 19\_\_\_\_ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

**NOTE:** Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9								●					
10	30		29		28		27		26	●	25		
11													
12	31		32		33		34		35		36		
13													


**A. Description of original monument and accessories and/or subsequent restoration:**  
 (K10) Quarter corner common to Sections 25-26. Remonumented in the original position in 1952 by Dean C. DeLaMater, RLS: "This corner was found by Forestry Division survey crew, while making a partial resurvey of the Township. One original B.T. still in place, in fair condition. 1" pipe with 4" brass cap. 12" W.Pine M16W 51 links, 12" W.Pine S65W 23 links."  
 (2-Sec. 27) East 1/16 corner between Sections 22-27. Not established in the original survey.

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

(K10) Recovered the 1952 monument, as described, in good condition and at record bearing and distance from the remaining 1952 witness W.Pine SW, now 20" dia. in good condition. Left the monument in place and made new witnesses as described below.  
 (2-Sec. 27) Established the corner midway and on a line of mean true bearing between Quarter corner 1326.45' West and Section corner 1326.45' East.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

(K1) Found 1" ID iron pipe with 4" brass MI Dept. of Conservation cap. Blazed and scribed:	(2) Set 1" ID x 32" iron pipe with 4" dia. alum. MDNR cap. Blazed and scribed:
5" Maple N61W 50.7' "1/4S NBT"	7" W.Pine N59E 15.5' "1/16S BT"
6" W.Pine S50E 29.8' do	10" W.Pine S43E 35.2' do
8" W.Pine S30E 17.5' do	10" W.Pine S65W 10.9' do
The 1952 wit: 20" W.Pine S71W 23 links, with overgrown blazes. Bearings are magnetic. Distances to notch in lower blaze.	10" Spruce N43W 19.1' do
	Set sq'd cedar post adjacent. Bearings are magnetic. Distances are to notch in lower blaze.

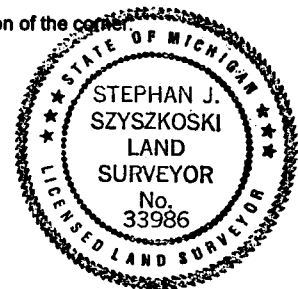

Signed by Stephan J. Szyszkoski  
 Surveyor's Michigan License No. 33986

Date 7/18/01

For the Michigan Department of Natural Resources - Forest Management Division