

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Dickinson	Located In:	Corner Code #
(County)		
1. Public Land Survey	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
2. Property Controlling in Section	S <u>27</u> T <u>43N</u> R <u>28W</u>	<u>5</u>
	S <u>26</u> T <u>43N</u> R <u>28W</u>	<u>4</u>
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

4 Jun 11 2001
 5 Jun 13 2001

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													


A. Description of original monument and accessories and/or subsequent restoration:
 (5-Sec. 27) North 1/16 corner, Section 27. Corner not established in the original survey.
 (4-Sec. 26) Northwest 1/16 corner, Section 26. Not established in the original survey.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(5-Sec. 27) Established and monumented the corner midway and on a straight line between Center of Section 1325.34' south and Quarter corner 1325.34' north. From the position thus established, I found a 3/4" dia. rebar, projecting 9", with a 1 3/4" dia. washer welded on top, not of record, bearing N37W, 20.8' distant. I did not accept the position of the 3/4" rebar as the corner position.
 (4-Sec. 26) Established the corner at the intersection of straight lines connecting opposite 1/16 corners.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(5) Set 1" IDx32" iron pipe with 4" dia. alum. MDNR cap. Blazed and scribed: 11" Oak N63E 50.6' 1/16S BT"	(4) Set 1" IDx32" iron pipe with 4" dia. alum. MDNR cap. Blazed and scribed: 3" Tamarack S69E 18.1' 1/16S BT"
6" W.Pine S54E 28.2' do	5" Tamarack S02E 40.2' do
29" W.Pine S10W 9.9' do	3" Tamarack S65W 29.9' do
Power Pole N71 3684, N07E 39.5' to nail with washer. Set a sq'd cedar post adjacent. Bearings magnetic. Dist. to trees are to notch in lower blaze.	15" R.Pine N03W 54.6' do 10' SW'ly to approx. C/L RR grade. Bearings are magnetic. Dist. to notch in lower blaze.

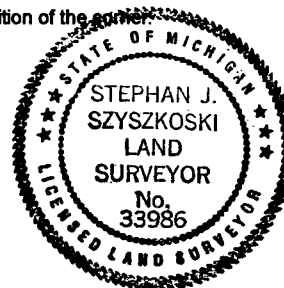

Signed by Stephan J. Szyszkoski Date 7/18/01
 Surveyor's Michigan License No. 33986

For the Michigan Department of Natural Resources - Forest Management Division