

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Dickinson
 (County)

Located In: Corner Code #

- | | | |
|------------------------------------|---------------------------|-----------|
| 1. Public Land Survey | T <u>44N</u> R <u>27W</u> | <u>D1</u> |
| | T ___ R ___ | ___ |
| | T ___ R ___ | ___ |
| | T ___ R ___ | ___ |
| 2. Property Controlling in Section | S ___ T ___ R ___ | ___ |
| | S ___ T ___ R ___ | ___ |
| 3. Miscellaneous Property in Sec. | S ___ T ___ R ___ | ___ |
| | S ___ T ___ R ___ | ___ |

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Aug 21 2000

I, Stephan J. Szyszkoski, in a field survey on _____, 19__ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		10		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:
 (D1) Quarter corner common to Section 5 T44N-R27W and Section 32 T45N-R27W. Reestablished by single proportionate measurement along the town line by Billy D. Buckler, RLS, in 1963. 1" pipe with 4" aluminum cap. 6" Hard Maple N63W 56 links, 6" Hard Maple S23W 47 links.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(D1) Recovered the 1963 monument, a 1" ID iron pipe capped with a 4" dia. cast aluminum Michigan. Dept. of Conservation tablet, in good condition and at record bearing and distance from the 1963 NBTs. The H.Maple SW is in good condition. The H.Maple NW is now a dead stub. Left the monument in place and made new witnesses as described below.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(D1) Found 1" ID iron pipe with 4" alum.

cap. Blazed and scribed:

- | | |
|---------------------|----------------|
| 7" Sugar S89W 39.2' | "1/4S NBT" |
| 6" Sugar N48W 24.9' | do |
| 5" Sugar N06E 35.2' | do |
| 9" Sugar S28W 31.1' | (The 1963 NBT) |

Bearings are magnetic. Distances to notch in lower blaze.

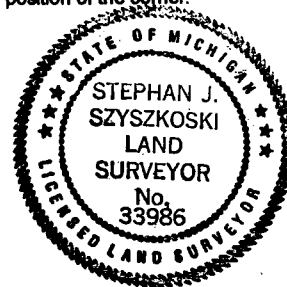

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 5/2/01

For the Michigan Department of Natural Resources - Forest Management Division