

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Dickinson</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>44N</u> R <u>28W</u>	<u>A9</u>
	T <u> </u> R <u> </u>	<u> </u>
	T <u> </u> R <u> </u>	<u> </u>
	T <u> </u> R <u> </u>	<u> </u>
2. Property Controlling in Section	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
3. Miscellaneous Property in Sec.	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
	S <u> </u> T <u> </u> R <u> </u>	<u> </u>

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Oct 01 1998

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5												
6	10		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												

A. Description of original monument and accessories and/or subsequent restoration:

(A9) Corner common to Sections 19-30 T44N-R28W and 24-25 T44N-R29W. Corner reestablished in 1959 by Billy D. Buckler, RLS. 1" pipe with 4" brass cap. 6" H.Maple S30W 53 links, 6" Elm N70E 49 links.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(A9) Recovered the 1959 monument, as described, in good condition, and at record bearing and distance from the 1959 accessories. The Maple is now stump remains only and the Elm is dead. Left the monument in place and made new witnesses as described below.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(A9) 1" pipe with 4" brass cap.

Blazed and scribed the following:


12" Sugar N43E 77.0' "S19 NBT"

12" Aspen S23E 24.2' "S30 NBT"

5" Balsam S22W 37.7' "S25 NBT"

6" Balsam S89W 33.6' "S25 NBT"

Squared cedar post adjacent. Bearings are magnetic. Distances are to notch in lower blaze.

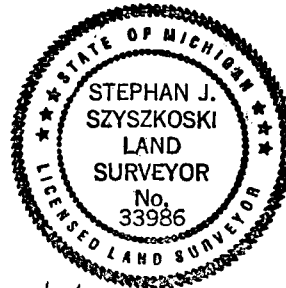

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 3/7/00

For the Michigan Department of Natural Resources - Forest Management Division