

LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Dickinson</u>	Located In:	Corner Code #
(County)		
1. Public Land Survey	T <u>44N</u> R <u>28W</u>	<u>19</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S <u>26</u> T <u>44N</u> R <u>28W</u>	<u>3</u>
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Nov 03 1999

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:

(19) Corner common to Sections 22-23-26-27. Remonumented in 1952 by Dean C. DeLaMater RLS in the original position, according to an original B.T. 1" pipe with 4" brass cap. 6" Spruce S37E 3 links, 5" Spruce N88W 21 links, 5" Spruce N33E 13 links."
 (3-Sec. 26) North 1/16 corner between sections 26-27. Corner not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


(19) Recovered the 1952 monument, a 1" ID iron pipe capped with a 4" dia. brass Michigan Dept. of Conservation tablet, in good condition, and at record bearing and distance from the 1952 witnesses. The Spruce SE is a rotting stump, the Spruce NW is in good condition with scribing visible (N72W observed mag. bearing), and the Spruce NE is dead and down with notch and scribing visible. Left the monument in place and made three new witnesses as described below.

(3-Sec. 26) Established the corner midway and on a line of mean true bearing between Section corner 1315.67' north and Quarter corner 1315.67' south. At the position for the corner I placed a 1" I.O.x32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(19) Fd. 1" pipe with 4" brass cap.
 Blazed and scribed the following:
 5" B.Spruce N33E 14.1' "S23 NBT"
 7" Tamarack S34E 18.1' "S26 NBT"
 5" B.Spruce S50W 20.6' "S27 NBT"
 Bearings are magnetic. Distances to notch in lower blaze.

(3) Set 1" pipe with 4" MDNR cap.
 Blazed and scribed the following:
 6" Sugar N31E 3.0' "1/16S BT"
 12" Sugar S52E 7.4' do
 9" Sugar S41W 26.1' do
 7" Sugar N13W 22.3' do
 Squared cedar post adjacent. Bearings are magnetic. Distances to notch in lower blaze.

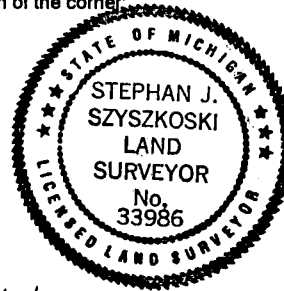

Signed by Stephan J. Szyszkoski Date 3/7/00
 Surveyor's Michigan License No. 33986

For the Michigan Department of Natural Resources - Forest Management Division