

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Dickinson

Located in:	Corner Code #
1. Public Land Survey	T 44N R 29W K1
	T 44N R 29W K3
	T R
	T R
2. Property Controlling In Section	S T R
	S T R
3. Miscellaneous Property in Sec.	S T R
	S T R

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

Jul 17 1996

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2			1	
3													
4	7		8		9		10		11			12	
5													
6	18		17		16		15		14			13	
7													
8	19		20		21		22		23			24	
9													
10	30		29		28		27		26			25	
11													
12	31		32		33		34		35			36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

(K1) Corner common to Sections 1-2 T44N-R29W, and 35-36 T45N-R29W. Corner monumented in 1956 by Billy D. Buckler, RLS: "Replaced Section Corner. Found old stake bottom in soil. Found three stp. holes in proper position. Distance checks East and West. Checked to bottom of hill 3.27 chain south. Distance North to 1/4 corner checks very close. Corner placed and witnessed September 25, 1956. Placed 1" iron pipe with 4" brass cap. Witnesses: 16" Red Pine N05W 222 links, Pit and Mound East 25 links." Found no subsequent record.

(K3) Corner common to Sections 1-2-11-12. Corner established in 1848 by John Burt: "Set Maple post...Hemlock 24 S26W 22, Fir 6 N22E 33." Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


(K1) Found and accepted Buckler's monument as described, in good condition, and at record bearing and distance from his 1956 accessories. Left the monument in place and marked two new witnesses as described below.

(K3) Original post and accessories not recovered. Found no acceptable evidence of the position of the original corner on the ground. Reestablished the corner by double proportionate measurement to the original record between monumented corners 81.461 ch. north, 80.188 ch. south, 80.242 ch. east, and 80.604 ch. west. At the position for the corner, I placed a 1" I.D. x 32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(K1) Found 1" pipe with 4" brass MI Dept. of Conservation cap. Blazed and scribed the following new bearing trees: 7" J. Pine S15E 55.0' (slope) "S1 NBT" 18" J. Pine N75E 53.9' Distance to find nail in S. face blaze. Fd. lower blaze unmarked. Blazed and scribed BH only. Bearings are magnetic.

(K3) Set 1" pipe with 4" MDNR cap. Blazed and scribed the following new bearing trees: 12" Red Pine N40W 43.7' "S2 NBT" Corner falls in poplar regeneration. No other witness trees available. MDNR mon. 1/4 2411, Westerly 2659.92' MDNR mon. 1/4 11612, Southerly 2646.23' MDNR mon. Corner common to 1&2 on the township line, Northerly 5376.45'. Bearings are magnetic.

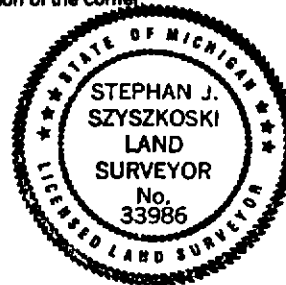

Signed by Stephan J. Szyszkoski
Surveyor's Michigan License No. 33986

Date Sept. 3, 1996

For the Michigan Department of Natural Resources - Forest Management Division