## **Gladwin County Remonumentation**

## LAND CORNER RECORDATION CERTIFICATE

PAGE	25
------	----

DEC 29 93 AM


	Filing Requirement of Act 74, Mich. P.A. 1976			
	Located In:	Corner Code ##		
rvey	T T17NR R1E	E:11 E-12		
	T A T R			

Register of Deeds Stamp & File Number

4.	Lot No,	Recorded Plat	
5.	Private Claims		

Craig W. McVean October 25 \_ , in a field survey on . 19 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

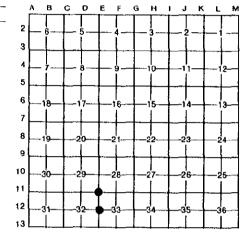

Description of original monument and accessories and/or subsequent restoration:

E-11 Intersect Meridian 2.36 CH. N of corner of Sec. 24 and 25, T17N, R1W - H. Parker, 1831. Maple 11" N 36° E 20 Lks.

Hemlock 12" S 9° E 26 Lks,

For corners in

Gladwin (County)

Public Land Su

in Section Miscellaneous

**Property Controlling** 

Property in Sec.

M.D.O.T. witnesses card - G.G.S. - 1957. Found 1/2" iron pipe.

M.D.O.T. witnesses card - Gilbert - 1961 - 3/4" iron rod in mon. box.

Dundas-witness prior to 1958.

M.D.O.T. ROW sheets - File #26-R-2; Control Section 26031, Sheet 28.

E-12 Not set in original survey.

M.D.O.T. witnesses card. G.G.S. - 1957. Found 1" iron.

M.D.O.T. witness card - Gilbert - 1961 - 1" iron pipe.

M.D.O.T. ROW sheets - File #26-R-2 - Control Section 26031,

Sheet 27,

Huron Cove Subdivision - L. 9 of Plat, P. 17; Woodby's Sunnyside Shores Subdivision - L. 7 of Plat, P. 17.

Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Closing corner common to Sec. 28 and 33, T17N, R1E. Found 3/4" iron rod in mon. box per M.D.O.T. witness cards. Monument accepted as the best available evidence of the position of the original corner. Accepted by Gladwin County Peer Review Group on 12-10-93.

OF MICHICAN CRAIG W. McVEAN PROFESSIONAL SURVEYOR

E-12 1/4 corner common to Sec. 33, T17N, R1E. Found 1/2" rebar at location of corner per M.D.O.T. witness cards, record and plat calls. Removed rebar. No reaction below 1/2" rebar. This position not established by original government surveyors. This monument is accepted as the best available evidence of the position of the corner. Accepted by Gladwin County Peer Review Group on 12-10-93.

POFESSIONAL C. Description of monument for corner and accessives ablished to perpetuate locating the position of the corner:

No. 39088

Could not remove 3/4" iron rod. Drove down. Set 2" Gladwin County aluminum cap on 5/8" x 24" rebar over rod in mon. box. 0.32' W of standard line and 1.6' ± W of centerline

S 70° W 160.30' to nail and tag in S side 18" Maple.

N 60° W 111.56' to nail and tag in S side P.P.

N 35° E 102.44' to nail and tag in W side L & W sign post.

S 20° E 111.05' to NW corner (wood face) of building.

0.32' E and 155.44' S (155.49' M.D.O.T. and 155.76' GLO) to M-9 -T17N - R1W.

E-12 Replace 1/2" x 18" rebar with 2" Gladwin County aluminum cap on 5/8" x 36" rebar. 6" Below gravel road and 0.58' W Of standard line.

N 76° W 54.51' to nail and tag in S side 8" Ash.

N 15° W 41.94' to nail and tag in SW side 24" Ash clump.

S 40° E 94.95' to nail and tag in SW side 6" Ash.

S 20° E 74.04' to concrete monument.

S 60° W 84.40′ to nail and tag in S side 8" Eim.

E 0.58' and S 156.96' (156.65' M.D.O.T. and 156.55' P.) to M-10 -T17N - R1W.

Surveyor's Michigan License No. ...

\_ Date \_

REVISED JAN., 1983