## FEB 1 8 1894

## **Gladwin County Remonumentation**

PAGE 20

ULL 29 193 AM

## 

## LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

	Gladwin (County)	Located In:	Corner Code ≠≠
1.	Public Land Survey	T18N. R1W.	
		T_18N_R _1W_	M-11
		T R	
		T R	
2.	Property Controlling	S	
	in Section	S T R	
3.	Miscellaneous	s	
	Property in Sec	STR	


SISTER POLICE

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_\_, Recorded Plat \_\_\_\_\_\_

5. Private Claims \_\_\_\_\_

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

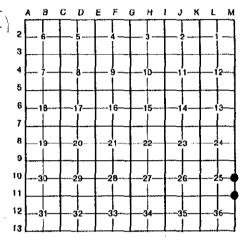

A. Description of original monument and accessories and/or subsequent restoration:

M-10 Set post - J. Brink, 1837. Hemiock 10" S 21-1/2"° W 43 Lks. Hemiock 8" N 27° W 26 Lks.

GLO Resurvey - 1877, Merrill. M.D.O.T. witness card - 1961, Gilbert - 3/4" rod in mon. box. M.D.O.T. right-of-way map file #26-R-2, Control Sec. 26031 - Sheet

Dundas - Iron pipe and witnesses - prior to 1958.

M-11 Found post - J. Brink, 1837. Hemlock 11" N 26° W 27 Lks. B. Ash 12" S 49° W 39 Lks.

GLO Resurvey - 1877, Merrill.

M.D.O.T. witness card - 1961 - Gilbert - 3/4" iron rod in mon. box.

M.D.O.T. right-of-way map - file #26-R-2, Control Section 26031,
Sheet 30.

Dundas witnesses - prior to 1958.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

M-10 Standard 1/4 corner common to Sec. 25, T18N, R1W. Found boat spike in mon. box at occupation fence to W - position agrees with M.D.O.T. distance call to E-12-T18N-R1E. Monument accepted as the best available evidence of the position of the original corner. Accepted by Gladwin County Peer Review Group on 12-10-93.

M-11 Standard Sec. corner common to Sec. 25&36, T18N, R1W. Found 3/4" iron rod in mon. box per M.D.O.T. witness card in agreement with M.D.O.T. and GLO distance call to E-13-T18N-R1E. Monument accepted as the best available evidence of the position of the original corner. Accepted by Gladwin County Peer Review Group on 12-10-93.

C. Description of monument for corner and accessories established to perpetuate locating the position of the college of the co

M-10 Replace boat spike with 2" Gladwin County alum. cap on 5/8" x 24" rebar in mon. box - 0.4'± W of centerline of M-30. S 43° E 47.22' to nail and tag in SW side Fence Post. N 53° E 42.65' to nail and tag in NW side Fence Post. N 26° W 122.57' to nail and tag in SW side P.P. S 85° W 69.64' to nail and tag in N side 8" Pine. S 20° W 118.69' to nail and tag in NW side 10" Maple. S 308.36' (308.35' M.D.O.T.) and 1.38' W to closing corner E-12-T18N-R1E.

M-11 Could not remove 3/4" iron rod - drove down - set 2" Gladwin County alum. cap on 5/8" x 36" rebar over rod in mon. box 1.6'± E of the centerline of M-30.

N 60° W 72.67' to nail and tag in NE side 10" Pine.

S 60° W 70.39' to nail and tag in N side P.P.

N 85° E 76.45' to nail and tag in N side 8" Ash.

N 25° W 82.74' to nail and tag in W side 6" Pine.

S 310.69' (310.60' M.D.O.T. and 310.21' GLO) to closing township corner E-13-T18N-R1E.

Signed by _	Criais	W.	Me	Vear	
-	lichigan License	e No. 39088			

Date 12/20/93

CRAIG W. McVEAN
PROFESSIONAL
SURVEYOR
NO.