

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Houghton</u> (County)	Located in:	Corner Code #
1. Public Land Survey	T <u>51N</u> R <u>35W</u>	<u>F9</u>
	T <u> </u> R <u> </u>	<u> </u>
	T <u> </u> R <u> </u>	<u> </u>
	T <u> </u> R <u> </u>	<u> </u>
2. Property Controlling in Section	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
3. Miscellaneous Property in Sec.	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
	S <u> </u> T <u> </u> R <u> </u>	<u> </u>

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Apr 13 1999

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5												
6	18		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												


A. Description of original monument and accessories and/or subsequent restoration:
 (F9) Quarter corner common to Sections 21-28. Original corner established in 1848 by Sylvester Higgins: "West corrected between Secs 21 & 28...40.15 Set 1/4 Section post on true line. Sugar 14 N25W 7, Birch 12 S57E 17." Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(F9) Original post and accessories apparently destroyed by road construction. Recovered an old line fence going north from corner position which was in place prior to 1930, according to Mr. Peter Hiltunen, a local land owner. Mr. Hiltunen told me that the fence has always, to his knowledge, been locally accepted as the boundary between the SE1/4 and SW1/4 of Section 21. Also recovered remains of 33' R/W fence on S. side of North Laird Rd. about 100' east of the corner position. Reestablished the corner on the southerly extension of the 1/4 line fence at it's intersection with a line passing from the Section corner 21-22-27-28 through a point 33.00' N. of the R/W fence. At the position for the corner, placed a 1" ID x32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped, driven to 6" below the road surface. Found the distances West and East to monumented section corners to be 2692.80' and 2625.77', respectively.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(F9) Set 1" pipe with 4" MDNR cap.
 Stop sign S01E 81.3' to post center
 Power pole S26N 103.8' PK nail/washer
 Power pole N38W 36.2' do
 Blazed and scribed:
 16" Sugar N04E 57.65' "1/4S NBT"
 Bearings are magnetic. Distance to
 Sugar is to notch in lower blaze.

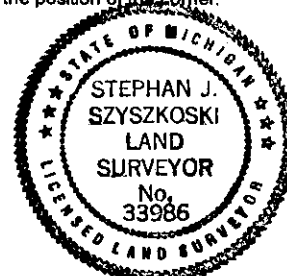

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 8/26/99

For the Michigan Department of Natural Resources - Forest Management Division