

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Houghton
 (County)

Located In:

Corner Code #

- | | | |
|------------------------------------|---------------------------|------------|
| 1. Public Land Survey | T <u>51N</u> R <u>36W</u> | <u>K12</u> |
| | T _____ R _____ | _____ |
| | T _____ R _____ | _____ |
| | T _____ R _____ | _____ |
| 2. Property Controlling in Section | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |
| 3. Miscellaneous Property in Sec. | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Sep 14 1999

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:
 (K12) Quarter corner common to Sections 35-36. Corner reestablished in 1962 by Billy D. Buckler RLS at an old fence corner. 1" pipe with 4" brass cap. 12" Y. Birch N85W 43 links, 10" Y. Birch N02W 33 links.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


(K12) The 1962 monument was found disturbed by a falling tree, which tree also damaged the record Y. Birch N02W. Remonumented the corner with the 1962 monument, a 1" ID iron pipe capped with a 4" dia. brass Michigan Dept. of Conservation tablet, at record bearing and distance from the 1962 Y. Birch N85W (now N82.5W mag.), recovered in good condition.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
 (K12) 1" pipe with 4" brass cap.

Blazed and scribed the following:

- 11" Y. Birch N34E 35.0' "1/4S HBT"
- 5" Sugar S25E 18.4' do
- 10" Sugar S66W 7.7' do
- 10" Y. Birch N11W 30.9' do

Squared sugar post adjacent. Bearings are magnetic. Distances are to notch in lower blaze.

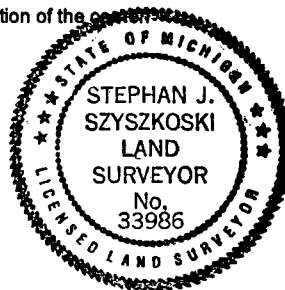

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 3/7/00

For the Michigan Department of Natural Resources - Forest Management Division