

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

Houghton

(County)

Located In:

Corner Code #

1. Public Land Survey

T 51NR 36W      J5  
T 51NR 36W      L7

2. Property Controlling in Section

T      R       
T      R     

3. Miscellaneous Property in Sec.

S      T      R       
S      T      R       
S      T      R     

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

L7 Jul 18 2000  
J5 Apr 04 2000

I, Stephan J. Szyszkoski, in a field survey on \_\_\_\_\_, 19\_\_\_\_ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5									●			
6	18	17	16	15	14	13						
7										●		
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

**A. Description of original monument and accessories and/or subsequent restoration:**

(J5) Quarter corner common to Sections 11-14. Remonumented in 1957 and recorded in 1958 by Billy D. Buckler, RLS. 1" pipe with 4" brass cap set from probable Sugar B.T. N28E 24 links, green but rotted out inside. 14" Hard Maple N77E 46 links, 14" Hard Maple S17E 91 links.

(L7) Quarter corner common to Sections 13-24. Reestablished in 1970 by A.O. Enger midway and on line between Section corners 40.13 chains east and west. 1" ID x 14" iron pipe with 4" aluminum cap. Red Maple 8 N19 1/2W 68.3', Sugar Maple 8 N13E 46.3'.

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

(J5) Recovered the 1957 monument as described, a 1" ID iron pipe capped with a 4" dia. brass Michigan Dept. of Conservation tablet, in good condition, and at record bearing and distance from the 1957 witnesses, both recovered in good condition with overgrown blazes. Left the monument in place and made two new accessories as described below.

(L7) Recovered the 1970 monument, as described, set firm in the gravel road bed of Pike Lake Road, with top bent over about 6" by road grader. Bottom portion of monument is straight and in good condition. Removed the monument from it's position, straightened it, reset in position, and drove to 6" below the gravel surface. The 1970 witnesses were recovered in good condition and are described below. Distances from the monument to these witnesses were remeasured and found to be both about 0.4' short of the record. This is probably due to inaccurate taping in 1970. There is a significant elevation difference between the monument and the witnesses, the monument being in a road cut. The location of the monument was found to be in accord with the 1970 record with respect to the adjacent section corners.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

(J5) Found 1" pipe with 4" brass cap.

The 1957 witnesses:  
16" Sugar N80E 30.4' overgrown blazes  
21" Sugar S19E 59.6' do


Blazed and scribed the following:  
9" Sugar S36W 15.6' 1/4S N8T"  
4" Y. Birch N32W 18.1' do

Placed squared Sugar post adjacent.  
Bearings are magnetic. Distances are to notch in lower blaze.

(L7) Found 1" ID iron pipe with alum. MDNR cap. Blazed and scribed:

5" Sugar S25E 41.0' 1/4S N8T"  
12" Y. Birch S11W 36.4' do

The 1970 wits:  
10" Sugar N18E 45.9' overgrown blazes  
12" Maple N14W 67.9' do  
Bearings are magnetic. Distances to notch in lower blaze.

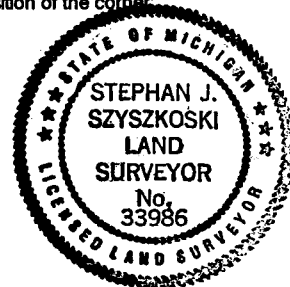

Signed by Stephan J. Szyszkoski  
Surveyor's Michigan License No. 33986

Date 11/6/01

For the Michigan Department of Natural Resources - Office of Property Management