

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Houghton
 (County)

Located In:

Corner Code #

1. Public Land Survey	T 52H R 35W	K8
	T 52H R 35W	L9
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

L9 Sep 20 2000
 K8 Sep 19 2000

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

A. Description of original monument and accessories and/or subsequent restoration:


(K8) Quarter corner common to Sections 23-24. Reestablished in 1972 by A.O.Enger RLS, midway and on line between section corners N and S. 1"ID x 36" iron pipe with 4" aluminum cap. Red Maple 5 S50E (mag.) 18.7', Red Maple 4 S54W (mag.) 15.5'
 (L9) Quarter corner common to Sections 24-25. Reestablished in 1972 by A.O.Enger RLS, midway and on line between section corners. 1"IDx36" iron pipe with 4" aluminum cap. Red Maple 4 N37W 20.5', Red Maple 4 S11E 16.0'. Enger placed collinear 1/16 corners 20.05 chains east and west of this corner in 1972.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(K8) The 1972 monument and SE NBT were not recovered. Reestablished the 1972 position at record bearing (corrected for change in declination) and distance from the 1972 SW NBT, found in good condition. The reestablished position checks well with 1972 corners north and south.
 (L9) The 1972 monument was found badly disturbed and out of position. The 1972 witnesses were not recovered. Reestablished the corner in the 1972 position, being midway and on line between the 1972 1/16 corner monuments found 1323.09' (20.047 chains) east and west.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(K8) Set 1"IDx32" IP with 4" alum. MDNR cap. Blazed and scribed:	(L9) Set 1"IDx32" IP with 4" aluminum MDNR cap. Blazed and scribed:
3" Balsam N56E 20.8' "1/4S NBT"	4" dbl Hemlock N25E 74.6' "1/4S NBT"
5" Cherry N77W 43.4' do	6" Maple N71E 79.5' do
5" Maple N28.5W 31.1' do	10" W.Spruce S18W 52.3' do
The 1972 wit: 6" Maple S57W 15.5'	10" Maple S77.5W 62.4' do
Bearings are magnetic. Distances to notch in lower blaze.	Bearings are magnetic. Distances to notch in lower blaze.

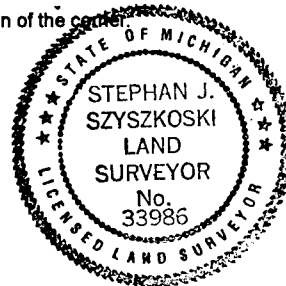

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 10/31/00

For the Michigan Department of Natural Resources - Forest Management Division