

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Houghton
 (County)

Located in:

Corner Code #

- | | | |
|------------------------------------|---------------------------|-------|
| 1. Public Land Survey | T <u>52N</u> R <u>35W</u> | F5 |
| | T <u>52N</u> R <u>35W</u> | F6 |
| | T _____ R _____ | _____ |
| | T _____ R _____ | _____ |
| 2. Property Controlling in Section | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |
| 3. Miscellaneous Property in Sec. | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Aug 24 1999

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5					●							
6	18		17		●		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												

A. Description of original monument and accessories and/or subsequent restoration:

(F5) Quarter corner common to Sections 9-16. Corner established in 1846 by S.W. Higgins: Set 1/4 section post. Sugar 12 N45E 16, Y. Birch 10 S10E 26. Found no subsequent record.

(F6) Center of Section 16. Corner not established in the original survey. According to Mr. Mel Goodreau, a local land owner since 1960, this corner was monumented prior to 1960 with a wooden post by Melvin C. Larsen, a local cruiser known to have done some surveying and once employed by Edward Charles, RLS. Also, according to Mr. Goodreau, Larsen's post was replaced by a 4" dia. concrete cylinder around 1963.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(F5) Original post and accessories were not recovered. Reestablished the corner midway and on a line of mean true bearing between monumented section corners 2647.7' east and west. At the position for the corner I placed a 1" ID x 32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. From the corner monumented, I found a 1" dia. iron pipe 28' north and 115' west, placed by local land owners ca. 1970. According to Mr. Mel Goodreau, one of the land owners involved, the pipe was placed by measuring north from the monumented center of Section 16 and west from the monumented corner common to Sections 9-10-15-16.

(F6) Found a 4" dia. concrete cylinder, projecting about 17" above ground with the remains of a wooden post adjacent. There are a number of 1" iron pipes placed in a line proceeding north from this position and extending for 1/2 mile. I determined that the concrete cylinder is 2.7' north and 6.5' west of the intersection of straight lines connecting opposite 1/4 corners and accept same as a careful and faithful determination of the position of the corner. Left the monument in place and marked accessories as described below.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(F5) Placed 1" pipe with 4" MDNR cap.

Blazed and scribed the following:

14" Sugar S17W 3.9' "1/4S NBT"

12" Y. Birch N58W 25.7' do

15" Y. Birch N12W 17.1' do

8" Y. Birch S77E 23.6' do

Placed a squared cedar post adjacent.

Bearings are magnetic. Distances are to notch in lower blaze.

(F6) Found 4" dia. concrete cylinder.

Blazed and scribed the following:

9" Sugar S66W 5.9' "C1/4 8T"


21" Hemlock N10E 32.9' do

6" Sugar N49E 17.1' do

10" Sugar S01W 12.5' do

Placed a squared sugar post adjacent.

Bearings are magnetic. Distances are to notch in lower blaze.

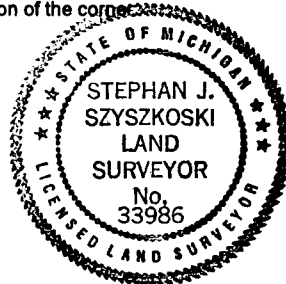

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 10/19/99

For the Michigan Department of Natural Resources - Forest Management Division