

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

<u>Houghton</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
2. Property Controlling in Section	S <u>16</u> T <u>52N</u> R <u>35W</u>	<u>13</u>
	S <u>16</u> T <u>52N</u> R <u>35W</u>	<u>16</u>
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

Aug 25 1999

I, Stephan J. Szyszkoski, in a field survey on \_\_\_\_\_, 19\_\_ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.


A. Description of original monument and accessories and/or subsequent restoration:  
 (13-Sec. 16) Southeast 1/16 corner, Section 16. Corner not established in the original survey. Found no subsequent record.  
 (16-Sec. 16) East 1/16 corner between Sections 16-21. Corner not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(13-Sec. 16) Found no evidence of prior monumentation at the corner position. Established the corner at the intersection of straight lines connecting opposite 1/16 corners. At the position for the corner, I placed a 1" ID x 32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped.  
 (16-Sec. 16) Found no evidence of prior monumentation at the corner position. Established the corner midway and on a line of mean true bearing between Quarter corner 1327.95' West and Section corner 1327.95' East. At the position for the corner I placed a 1" ID x 32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(13) Set 1" pipe with 4" MDNR cap. Blazed and scribed the following: 8" Sugar N05E 22.9'      "1/16S BT" 6" Sugar N86E 13.8'      do 15" Sugar S29E 14.4'      do 11" Sugar S75W 34.1'      do Placed a squared cedar post adjacent. Bearings are magnetic. Distances are to notch in lower blaze.	(16) Set 1" pipe with 4" MDNR cap. Blazed and scribed the following: 8" Sugar N49E 33.9'      "1/16S BT" 6" Sugar S22E 21.2'      do 11" Y. Birch S65W 9.3'      do 16" Hemlock N14W 18.5'      do Placed a squared cedar post adjacent. Bearings are magnetic. Distances are to notch in lower blaze.
---	---

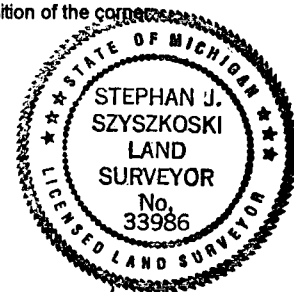

Signed by Stephan J. Szyszkoski  
 Surveyor's Michigan License No. 33986

Date 10/19/99

For the Michigan Department of Natural Resources - Forest Management Division