

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Houghton	Located in:	Corner Code #
(County)		
1. Public Land Survey	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
2. Property Controlling in Section	S <u>15</u> T <u>52N</u> R <u>35W</u>	<u>10</u>
	S <u>15</u> T <u>52N</u> R <u>35W</u>	<u>8</u>
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Aug 25 1999

I, Stephan J. Szyszkoski, in a field survey on _____, 19__ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													


A. Description of original monument and accessories and/or subsequent restoration:
 (10-Sec. 15) South 1/16 corner between Sections 15-16. Corner not established in the original survey. Found no subsequent record.
 (8-Sec. 15) West 1/16 corner Section 15. Corner monumented in 1980 by K.L.Sackett, RLS and re-monumented in 1994 by the undersigned, in the 1980 position.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(10-Sec. 15) Established the corner midway and on a line of mean true bearing between Quarter corner 1355.96' North and Section corner 1355.96' South. At the position for the corner, I placed a 1" ID x32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. From the corner monumented, I found a squared cedar post with location poster affixed N83W, 12 ft, for an approximate corner.
 (8-Sec. 15) Recovered the 1994 monument and determined that the 1980 position in which it was placed is erroneous. The 1980 position is 8.8' south of the proper position. I removed the 1994 monument and placed it midway and on a straight line between Quarter corner 1250.69' west and Center of Section 1250.69' east.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(10) Set 1" pipe with 4" MDNR cap. Blazed and scribed the following: 16" Y. Birch N47E 28.9' "1/16S BT" 6" Sugar S27E 11.7' do 6" Sugar S60W 34.1' do 9" Y. Birch N30W 50.6' do Placed existing cedar post S60E 4.5' on E. bank rd. Bearings are magnetic. Distances are to notch in lower blaze.	(8) Placed 1" pipe with 4" MDNR cap. Remeasured to the witness trees marked in 1994: 8" Sugar N42E 33.7' "1/16S 8T" 10" Sugar S50E 26.7' do 10" Hemlock S02W 25.5' healed blazes 16" Sugar S55W 10.6' "1/16S BT" Placed a squared cedar post adjacent. Bearings are magnetic. Distances are to notch in lower blaze.
--	---

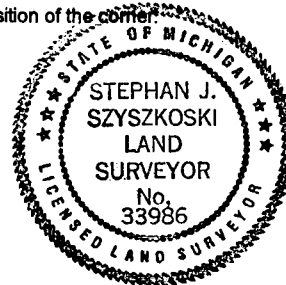

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 10/19/99

For the Michigan Department of Natural Resources - Forest Management Division