

**LAND CORNER RECORDATION CERTIFICATE**  
 Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Houghton</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
2. Property Controlling in Section	S <u>27</u> T <u>52N</u> R <u>36W</u>	<u>11</u>
	S ___ T ___ R ___	_____
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

Nov 18 1999

I, Stephan J. Szyszkoski, in a field survey on \_\_\_\_\_, 19\_\_\_ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

**NOTE:** Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:  
 (11-Sec. 27) Southwest 1/16 corner, Section 27. Corner not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(11-Sec. 27) Did not recover a corner monument at this position. The SW1/4 of Section 27 appears to have been subdivided by an unknown surveyor long ago, perhaps in conjunction with the construction of County Road E.R-83, now abandoned, which runs along the south E-W 1/16 line of Section 27. Recovered two ancient fences, running East and West, 16.5' north and 16.5' south of the centerline of the old road bed and also an ancient fence along the West N-S 1/16 line of Section 27. The road centerline and ancient fences work very well with the existing corner monumentation in this quarter section and I accept them as the perpetuation of an ancient survey, carefully and faithfully executed. I reestablish the 1/16 corner at the intersection of the centerline of the abandoned E.R-83 (as defined by a line parallel to and 16.5' from both fences), and a straight line connecting the monumented 1/16 corners on the north and south lines of the quarter section. This position falls directly on the existing N-S 1/16 fence. At the position for the corner I place a 1" ID x 32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped, set 6" below the center of the surface of the old road grade.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(11) Set 1" pipe with 4" MDNR cap.

Blazed and scribed the following:


8" Sugar S28E 45.6'      "1/16S 8T"

10" Sugar S38W 51.7'      do

7" Sugar N02W 34.5'      do

11" Basswood N70W 66.9'      do

Bearings are magnetic. Distances are to notch in lower blaze.

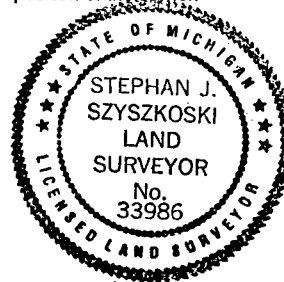

Signed by Stephan J. Szyszkoski  
 Surveyor's Michigan License No. 33986

Date 5/11/00

For the Michigan Department of Natural Resources - Forest Management Division