


LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970 as Amended

For corners in

<u>Houghton</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>52N</u> R <u>36W</u>	<u>K4</u>
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S <u>11</u> T <u>52N</u> R <u>36W</u>	<u>14</u>
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

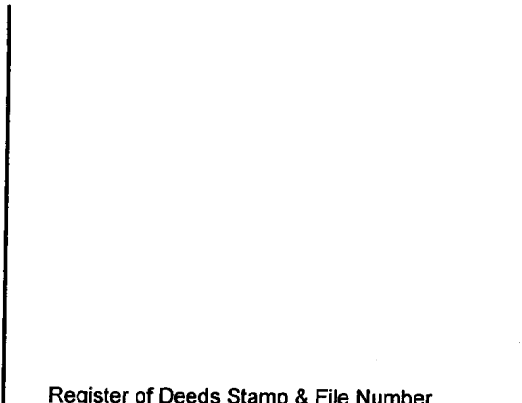

I, Stephan J. Szyszkoski, in a field survey on 14 08/19/2010 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
 (K4) Quarter corner common to Sections 11 and 12. 1846 - Established by Hiram and Sylvester Higgins, Deputy Surveyors, midway and on the Section line between Section corners 40.00 chains north and south. Set post at foot of hill. Sugar 14" N50E 9 links, Sugar 15" S45W 22 links. Found no subsequent record.

(14-Sec. 11) South 1/16 corner between Sections 11 and 12. Not established in the original survey.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
 (K4) The original post and accessories were not recovered. Found no acceptable evidence of the position of the original corner on the ground. Reestablished the corner midway and on the Section line between Section corners 2670.92' north and south, proportionate to the original record. The position for the corner falls on a rock face and cannot be adequately monumented. Established and monumented a WITNESS CORNER 23.00' north of the corner position and on the Section line.

(14-Sec. 11) Established the corner midway and on the Section line between Section corner 1335.46' south and Quarter corner 1335.46' north. The approx. center of an old RR grade, now MDNR snowmobile trail running NE-SW is 15' south of the corner position.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
 (K4) Set 1"IDx32" I.pipe with 4" alum. MDNR cap 23.00' north of the corner position and on the Section line. Set measuring nail/tag in:
 9" Sugar N25E 15.6' mrkd "WC BT"
 13" Sugar N84E 15.8' do
 13" Sugar S12E 2.6' do
 7" Sugar N26W 13.7' do
 Sq'd cedar post adjacent. Bearings magnetic. Monument cap is stamped to identify the corner.
 (14) Set 1"IDx32" I.pipe with 4" alum. MDNR cap. Set measuring nail with MDNR tag in the side of:
 6" Sugar N43E 21.0' mrkd "1/16S BT"
 3" Sugar S68E 36.3' do
 11" W.Spruce South 32.2' do
 6" Sugar S84W 15.35' do
 Sq'd cedar post adjacent. Bearings magnetic.

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 08/30/2010



For the Michigan Department of Natural Resources and Environment, Forest Management Division

16504
16506