

Nov. 6, 1998  
 Robert W. Campbell

**LAND CORNER RECORDATION CERTIFICATE**  
 Filing Requirement of Act 74, Mich. P.A. 1970

For corners in Houghton  
 (County)

Located In:

Corner Code #

- |                                      |   |            |   |            |   |
|--------------------------------------|---|------------|---|------------|---|
| 1. Public Land Survey                | T | <u>54N</u> | R | <u>33W</u> |   |
|                                      | T | <u>54N</u> | R | <u>33W</u> | ✓ |
|                                      | T | _____      | R | _____      |   |
|                                      | T | _____      | R | _____      |   |
| 2. Property Controlling in Section   | S | _____      | T | _____      | R |
|                                      | S | _____      | T | _____      | R |
| 3. Miscellaneous Property in Section | S | _____      | T | _____      | R |
|                                      | S | _____      | T | _____      | R |

ROBERT F. MIKESCH 11/11/98  
 HOUGHTON COUNTY, REGISTER 09:40  
 3/ 518 PAU Fee: 9.00  
 Page 1 of 1

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

Ronald S. Haataja, in a field survey on August 17, 19 98, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L
2	6			5				4		3		2
3												
4	7			8				9		10		11
5												
6	18			17				16		15		14
7												
8	19			20				21		22		23
9												
10	30			29				28		27		26
11												
12	31			32				33		34		35
13												


**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

**A. Description of original monument and accessories and/or subsequent restoration:**

- (M-6) E 1/4 Corner Section 13, T54N-R33W  
 40.00 Set Quarter Section post  
 Witnesses: Fir 6" N45°W 15 lks.  
 Do 8" S79°E 5 lks.
- (M-7) SE Corner Section 13, T54N-R33W  
 80.00 W. Pine 10" Corner of Sections 13 & 24  
 Witness: Fir 12" N22°E 28 lks.

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

- (M-6) E 1/4 Corner Section 13, T54N-R33W  
 Found 2" O.D. Pipe 16" above ground
- (M-7) SE Corner Section 13, T54N-R33W  
 Found 1 1/2" pipe loose in rotting pine stump, tightened by driving 1/2" pin through stump and cementing pipe onto pin. Found near a Quincy Mining Co. Tag in a tree

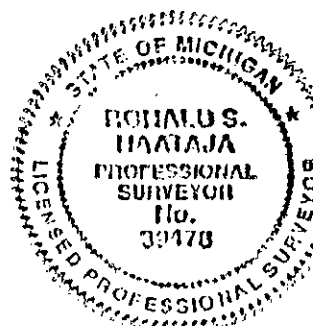

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

- (M-6) E 1/4 Corner Section 13, T54N-R33W  
 Stamped and cemented a brass remon. cap into pipe  
 Witnesses: Brass tags PS#39478 nailed into side of trees  
 12" Soft Maple S78°E 26.97', 5" Sugar Maple N08°W 11.50',  
 24" Oak S70°W 8.39', 6" Y. Birch S2°W 5.60', 3/4" sq. pin  
 S13°E 8.46'
- (M-7) SE Corner Section 13, T54N-R33W  
 Stamped and cemented a brass remon. cap into pipe  
 Witnesses: Brass tags PS#39478 nailed into side of trees  
 6" Maple w/QMC tag S52°W 22.19', 5" Maple N67°W 18.54',  
 8" Y. Birch N08°E 9.18', 3" Balsam S58°E 14.84'.

Signed by Ronald S. Haataja Date November 6, 1998

Surveyor's Michigan License No. 39478