LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

RNER

JAN 2 5 2000

Houghton County Located in: Corner Code # 1. Public Land Survey T55N R33W 1 - 7 T R T R T R 2. Property Controlling S T R in Section S T R S Miscellaneous T R Property in Sec.

SECTION 1P Register of Deeds

Houghton County, Register LC 4/53 Page 1 of 1

Mary Schoos

Time 10:37:39 PAU Date 12/30/1999 9 (2)(2)

Register of Deeds Stamp & File Number


4 Lot No.

, Recorded Plat

Private Claims

I, Joseph C. Domitrovich, in a field survey on October 15, 1997, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

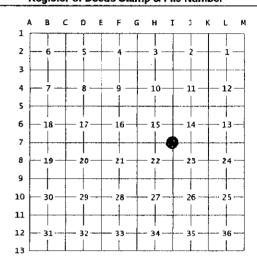

- A. Description of original monument and accessories and/or subsequent restoration:
 - (I 7) Corner of Sections 14, 15, 22 & 23, T55N R33W.
 - 1846 L.S. Scranton set a post with ties:

12" Sugar N 73°W 18 links S 67°E 14" Sugar 20 links

- H.W. Fesing, Engineer, on a survey map of the subdivision of Section 14, T55N, R33W, (on file with Steve Hein, P.S. of Laurium) states that he replaced a cedar post with an I.P. and that he found evidence of bearing trees.
- Joseph C. Domitrovich, P.S. 37273, for Duane Wood, P.S. 24625, found a 1" bent iron pipe at the corner and replaced it with a ½" x 36" iron pin encased in concrete. (Houghton County Airport Survey)
- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I recovered the above concrete monument. Its position works well with distances to corners called for by Fesing on his map and field notes:

SW corner section 15	S 88°17'47"W	5353.93° m.	(5358.54' Fesing)
Pipe on South line Sec. 14	N 89°20'03"E	4026.97' m.	(4028.47' Fesing)
NW corner section 14	N 01°18'59"W	5287.14' m.	(5290.8' Fesing)
SE corner section 22	S 00°37'37"E	5330.29' m.	(5324.12' Fesing)

I accepted the concrete monument as the section corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner is a 1/2" x 36" iron pin encased in a 4" diameter concrete cylinder. It falls in a heavily clearcut area. Ties:

5" Hard Maple	S 02°E	31.16'
7" Oak	S 35°W	105.62'
3" Hard Maple	N 36°W	45.27'
14" Dead Hemlock	N 22°W	17 31'

NOTE: Bearings to witness objects are magnetic. Distances are to a nail in side of the witness object unless noted.

Signed by

122/99

Surveyor's Michigan License No. 37273

WIE NION

3.0

JOSEPH DOMITROVICH LAND Surveyor

LAND T