OCT 2 9 1996

REMONUMENTATION

Re-Man Liber, Page 19

	•	•
MMISSION	LAND CORNER RE	CORDATION CERTIFICATE
	Filing Requirement	t of Act 74, Mich. P.A. 1970

COMMISS	OV
For corners in	

Huron	Located In:	Corner Code #
(County)		
1. Public Land Survey	Paris T <u>15N</u> R TR TR	14E C-13, D-13
Property Controlling in Section Miscellaneous Property in Sec.	S TR S TR S TR S TR	

STATE OF MICHIGAN HURON COUNTY RECORDED


10 SEP 96 8:42 A.M.

FRANCES L. HOLDWICK
Register of Person Stamper Figure Number

4. Lot No	, Recorded Plat
5. Private Claims	

I, <u>Charles S. Getz</u>, in a field survey on <u>July 2</u>, 19 <u>96</u> do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

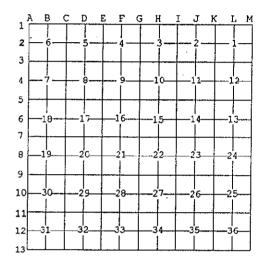

- A. Description of original monument and accessories and/or subsequent restoration:
- C-13 GLO Notes
 Set Post at 80.00 Chains
 Beech 7", N11°E, 42 Links
 Hemlock 8", N60°W, 1 1/2 Links

County Surveyor's Record - None, Act 74 - None, Act 132 - None

D-13 GLO Notes Set 1/4 Post at 40.00 Chains Beech 12", N11°E, 1 Link Hemlock 11", N40°W 15 Links

County Surveyor's Record - None, Act 74 - None, Act 132 - None

- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
- C-13

SW Cor, Section 32, T15N-R14E Found 1/2" Iron Bar in Centerline of Gravel Road (Huron Line Road), 33.66' West of 1/2" Iron Bar in \underline{C} of Huron Line Road & Maurer Road to South

APPROVED PEER BOARD MEETING
RLB Sept 7, 1996

D-13 s 1

S 1/4 Cor, Section 32, T15N-R14E Found No Evidence of an Existing Corner at site, (Huron Line Road). Set 1/2" Iron Bar on straight line at half distance between SE Cor, Section 32, T15N-R14E and SW Cor, Section 32, T15N-R14E.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Missional Sulli

C-13
SW Cor, Section 32, T15N-R14E
1/2" Iron Bar in Gravel Road Bed
East 33.66' to 1/2" Iron Bar in Gravel Road Bed
S15°W 53.84' to Nail in NW Side of Power Pole
N45°E 43.80' to West Leg of Road Sign
S50°E 59.00' to Stop Sign
West 2646.51' to S 1/4 Cor, Sec 31, T15N-R14E
East 2637.65' to S 1/4 Cor, Sec 32, T15N-R14E

D-13
S 1/4 Cor, Section 32, T15N-R14E
1/2" Iron Bar in Gravel Road Bed
S50°W 83.68' to Nail in N. Side of Power Pole
S70°W 148.50' to Nail in N. Side of 18" Pine
S50°E 59.00' to Nail in N. Side of Fence Post
West 2637.65' to SW Cor, Sec 32, T15N-R14E
East 2637.65' to SE Cor, Sec 32, T15N-R14E

Signed by	Charles S.		Set millimining		
	Michigan License No	. 25843	78,	3,00	3.2
•	-		= **	Charles S. Get Land Surveyor	Z

Date _____July 15, 1996

CORMANDPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971 REVISED MAY 14,1975 REVISED JAN., 1883 REVISED OCT., 1995