

REMONUMENTATION

OCT 29 1996

COMMISSION

Re-Man Liker 1, Page 2

REMONUMENTATION

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

For Corners in

	Located in:	Corner Code #
<u>Huron</u> (County)		
1. Public Land survey	Brookfield T <u>15 N</u> R <u>10 E</u>	<u>D-13</u>
	T _____ R _____	<u>E-13</u>
	T _____ R _____	
	T _____ R _____	
2. Property Controlling in Section	S _____ T _____ R _____	
	S _____ T _____ R _____	
3. Miscellaneous	S _____ T _____ R _____	

STATE OF MICHIGAN  
HURON COUNTY  
RECORDED

12 SEP 96 11:22 A.M.

FRANCES L. HOLDWICK  
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

- 4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_
- 5. Private Claims \_\_\_\_\_

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

I, James T. Meek, in a field survey on August 30, 1996, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules thereof as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

Original Survey South Bdy. T15NR10E, 1835, Harvey Parke, D.S.

D-13: South ¼ Corner of Section 32  
Post  
Hemlock 10", N52°E, 15 links  
Cedar 8", N35¼°W, 28½ links

E-13: Corner of Sections 32 & 33  
Post  
Cedar 17", N85°E, 25 links  
Birch 10", N70¼°W, 58 links

County Surveyor's Record: Wood post  
with iron pin, May 16, 1983  
No recorded surveys or LCRC

County Surveyors Record: Wood Post  
with iron pin, May 16, 1983  
Recorded Surveys: Liber 2, Page 218, ¼" iron

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

D-13: South ¼ Corner of Section 32

E-13: Corner of Sections 32 & 33

There is no remaining evidence of the original corner position

Found 1" pipe, 4" below grd.  
At centerline Huron Line Rd., 7' West of  
interesection with Pobanz Rd.

Accepted as the best available evidence of original corner position

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

D-13: South ¼ Corner of Section 32

E-13: Corner of Sections 32 & 33

At proportionate distance,  
Set T iron with cap #39089  
From which:  
Occupation field lines bear North and South  
At centerline Huron Line Rd.  
Nail in Wood post bears North 30.5'  
Nail power pole bears South 48.0'  
¼" iron flush with ground bears N67°E, 25.0'  
¼" iron flush with ground bears S62°W, 25.0'


Set ¼" iron w/cap #39089,  
3" below grd. over 1" pipe  
From which:  
Stop sign post bears N15°W, 29.2'  
Nail in power pole bears N60°W, 62.75'  
West direction sign post bears South, 23.9'  
Nail in power pole bears S62°E, 67.1'  
¼" iron, 3" below grd. bears East, 28.41'

Signed by James T. Meek

Date September 9, 1996

Surveyor's Michigan License No. 39089

APPROVED AT PEER BOARD MEETING, 9-9-96 RLB

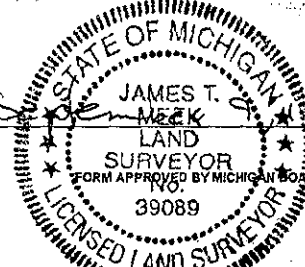

REVISÉD JAN., 1983