

1993

88329

RECORDED  
HILLSDALE CO. MICH.

LIBER 3 PAGE 27

COMMISSION REMONUMENTATION

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

'93 DEC 22 PM 2 22

For corners in

Hillsdale

(County)

Located In:

Corner Code #

- 1. Public Land Survey T 7S. R 4W. I-8  
T \_\_\_\_\_ R \_\_\_\_\_  
T \_\_\_\_\_ R \_\_\_\_\_  
T \_\_\_\_\_ R \_\_\_\_\_
- 2. Property Controlling S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_  
in Section S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_
- 3. Miscellaneous S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_  
Property in Sec. S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_

*Justy VanZandt*  
REG. OF DEEDS

Register of Deeds Stamp & File Number

- 4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_
- 5. Private Claims \_\_\_\_\_

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2				
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22	⊕	23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

Frederick J.

I, Cutcher, in a field survey on December 22, 19 93, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:


Stone and earthen according to Geo. Mark in a survey made May 9 & 11, 1911 as recorded in Book IX, Page 353, record of surveys at Register of Deeds Office. Gave witness of "Original iron corner post at S.E. cor. of cemetery West 34'.

LCR Liber 1, Page 37, Sept. 3, 1971 by A. John Hatt: Set iron rod in pavement 34.0' E. of broken off iron post in concrete in line with square concrete post at S.W. corner of cemetery at centerline of M-49 pavement.

This cor. rec'd. in Liber 1, Page 584, Aug. 21, 1978 by F.Cutcher, rec'd. in error as corner G-8.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

On this date I found R.R. Spike in centerline of M-49 according to LCR.

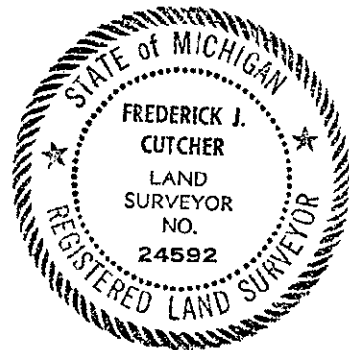

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Replaced R.R. Spike with 3/4" x 36" steel rod with cap (County issue) in monument box. In centerline of Highway M-49; 2.4' South of fence to East.  
N.W. cor. steel fence post N 89° E 32.10'  
S.E. cor. "Keefer" headstone N 73° W 45.15'  
S.E. cor. "Frick" headstone N 25° W 86.00'  
S.E. cor. concrete headwall N 60° W 23.6'

And is accepted as a careful and faithful reestablishment of the position of the original corner.

Signed by *Frederick J. Cutcher*

Date December 22, 1993

Surveyor's Michigan License No. 24592