

**SURVEY & REMONUMENTATION**

FILED

Nov 22 11 47 AM '94

**LAND CORNER RECORDATION CERTIFICATE**  
 Filing Requirement of Act 74, Mich. P.A. 1970  
 BUNKER HILL

REGISTER OF DEEDS  
*Paul J. Higgins*  
 INGHAM COUNTY, MICHIGAN

For corners in INGHAM (County) **COMMISSION**  
 APR 10 1995

Located In: Corner Code: //

- 1. Public Land Survey T IN R IE D-8  
 T R  
 T R  
 T R
- 2. Property Controlling S T R  
 in Section S T R
- 3. Miscellaneous S T R  
 Property in Sec. S T R

Register of Deeds Stamp & File Number

- 4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_
- 5. Private Claims \_\_\_\_\_

I, Maurice H. Mahieu, in a field survey on October 28, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2				
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:

D-8 Not set in original Government Survey

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


Corner was not set in the original Government survey and no recorded history of the corner position was found. The position of the corner was set at the intersection of the lines connecting the 1/4 corners. Set standard 3/4" x 24" iron rod with cap "P.A.-345 #28414" 2.00' West of true corner location. A 24" Red Oak occupies the true corner's position. Corner falls 6.5' South of downed East-West fence line. Also, corner falls on Southerly edge of woodline. Measured Southerly 2634.90' to D-9, Northerly 2610.10' to D-7, Westerly 2637.91' to C-8 and Easterly 2627.38' to E-8. Placed two large stones adjacent to 3/4" iron rod.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 3/4" x 24" Iron Rod with cap "P.A. 345 #28414" 2.00' West of true corner position.

Witnessed by:

- Nail and Tag #28414 N. side 24" Oak, East, 2.05'
- Nail and Tag #28414 N. side 32" Oak, S 30 deg. W. 12.80'
- Nail and Tag #28414 S. side 18" Hickory, N 80 deg. W. 17.67'
- Nail and Tag #28414 S. side 36" Oak, N 60 deg. W 25.68'

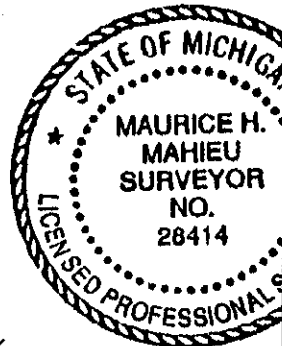

Signed by *Maurice H. Mahieu*  
 Surveyor's Michigan License No. #28414

Date 11-14-94