LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

Iron	Located In:	Coi	rner Code#
(County)			
1. Public Land Survey	T_428 T1 T1	२ <u>31</u> ॥ २	£7
Property Controlling in Section Miscellaneous Property in Sec.	S_20 T_42H S_ T S T S T	₹ <u>31</u> # ₹	7


Register of Deeds Stamp & File Number

, Recorded Plat 4. Lot No. 5. Private Claims

> Aug 07 1996 Aug 13 1996 E 7

_, 19 Stephan J. Szyszkoski , in a field survey on do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

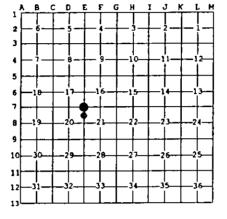

Description of original monument and accessories and/or subsequent restoration:

(ET) Corner common to Sections 16-17-20-21. Corner established in 1849 by John Burt. 80.00 Set cedar post corner of Sec. 16,17,20,21. Fir 10 N38W 10, W. Pine 20 S58E 10". Records of Misconsin Michigan Power Company (now Misconsin Electric Power Company) in the form of a map titled PROPERTY MARKERS PAINT AND MICHIGAMME RIVERS map #6-210-GG dated 4/10/1947 show in regard to this corner: *24" down pine sq. on side toward corner. Set concrete marker. 5" spruce N30W 22.9", 5" N. Pine N54E 20.4", 12" N. Birch S45W 12.2". (7-Sec. 20) North 1/16 corner between Sections 20-21. Corner not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner.

(E7) Original post and accessories not recovered. Found a 7" truncated right rectangular pyramid shaped concrete monument with a 3" square brass tablet affixed on the top which is stamped to read: "Misconsin Michigan Power Company...42-31 16-17-20-21". Recovered the MMPCD witnesses as follows: 20° Spruce N30W 22.9' in good condition, 9° W. Pine, dead with no markings visible, M54E 20.4' to center. The M. Birch was not found. Accepted the monument as the best available evidence of the position of the original corner. (7-Sec. 20) Found no evidence of prior monumentation at the corner position. Established the corner on a straight line between 1/4 quarter corner 1310.38' south and section corner 1310.38' north. At the position for the corner, I placed a 1"I.D.x32" iron pipe capped with a 4" dia. cast aluminum MONR tablet, appropriately stamped.

C.	Description of monus	ment for corner and	accessories established to perpetuate locating	the position of the corner:

(E7) Found WHPCO concrete monument. Blazed and scribed the following new bearing trees:

(7) Set I' pipe with MDNR aluminum cap. Blazed and scribed the following bearing

trees:

24" N. Pine \$06W 45.1' "S20 NBT" 10° Cedar S44N 38.4° "520 NBT" 16" Red Pine N47W 50.3 "S17 NBT" 3" Maple NO4M 38.4" "1/16S BT" 4" N. Spruce N55E 6.7 "1/165 BT" 8" Maple \$24E 40.1" "1/16S BT"

9" double Maple \$56M 52.7" "1/16S 87" 15" Cedar N52E 70.5' "S16 NBT" Placed a squared maple post adjacent.

Placed a 5° squared poplar post adjacent. Bearings are magnetic.

SURVEYOR LANDS ENGINEERING.

SZYSZKOSKI

LAND

Surveyor's Michigan License No

Bearings are magnetic.

For the Michigan Department of Natural Resources - Forest Management Division