

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Iron	Located In:	Corner Code #
(County)		
1. Public Land Survey	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
2. Property Controlling in Section	S 20 T42N R 31W	5
	S 20 T42N R 31W	6
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

Aug 12 1996

I, Stephan J. Szyszkoski, in a field survey on \_\_\_\_\_, 19\_\_\_\_ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5												
6	18		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												

A. Description of original monument and accessories and/or subsequent restoration:  
(5-Sec. 20) North 1/16 corner, Section 20. Corner not established in the original survey. Found no subsequent record.  
(6-Sec. 20) Northeast 1/16 corner, Section 20. Corner not established in the original survey. Found no subsequent record.


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(5-Sec. 20) Found no evidence of prior monumentation at the corner position. Established the corner on a straight line between Quarter corner 1314.34' north and Center of Section 1314.34' south. Center of Section is not monumented. It's position falls in Peavy Pond. At the position for the 1/16 corner, I placed a 1" I.D. x 32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped.

(6-Sec. 20) Found no evidence of prior monumentation at the corner position. Established the corner at the intersection of straight lines connecting opposite 1/16 corners, those North, East, and West, being monumented. At the position for the corner, I placed a 1" I.D. x 32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(5) Set 1" pipe with MDNR aluminum cap.	(6) Set 1" pipe with MDNR aluminum cap.
Blazed and scribed:	Blazed and scribed the following bearing
10" Poplar N25W 24.5'    1/16S BT	trees:
2" Maple N55E 19.4'    1/16S BT	3" Spruce S27W 4.2'    1/16S BT
2" Maple S61E 12.6'    1/16S BT	7" Spruce N33W 34.4'    1/16S BT
3" Maple S82W 5.4'    1/16S BT	10" Spruce N29E 9.2'    1/16S BT
Center of 2" steel pipe fence post E.	12" Spruce S51E 53.8'    1/16S BT
Side drive to mobile home N10E 93.7',	Placed a 3" squared spruce post
Nail and MDNR ref tag in wood corner	adjacent. Bearings are magnetic.
fence post, fence NE-NW, N84E 64.5'.	
Brgs. magnetic.	

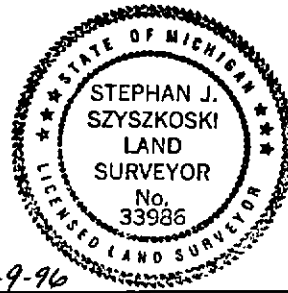

Signed by Stephan J. Szyszkoski  
Surveyor's Michigan License No. 33986

Date 9-9-96

For the Michigan Department of Natural Resources - Forest Management Division