## LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in  Iron	Located in:	Corner Code #
(County)		
1. Public Land Survey	7 12H R T R T R	
Property Controlling     in Section     Miscellaneous     Property in Sec.	TR S_20 T_42H R S TR S TR S TR	31W 3


Register of Deeds Stamp & File Number

Recorded Plat 4. Lot No. 5. Private Claims

Aug 13 1996 A8 Aug 14 1996

Stephan J. Szyszkoski in a field survey on do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

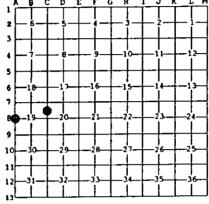

Description of original monument and accessories and/or subsequent restoration: (AB) Corner common to Section 19 T42N-R31N and Section 24 T42N-R32N. Corner established in 1846 by Milliam A. Burt: "40.00 Set spruce post or Section corner. Y. Birch 10 N68E 3, spruce 9 S51W 12". Records of Misconsin Michigan Power Company (now Misconsin Electric Power Company) in the form of a map titled PROPERTY MARKERS PAINT AND MICHIGAMME RIVERS map #G-210-GG dated 4-10-1947 state in regard to this corner: 1 orig. BY set concrete marker. 7" Balsam M27M 7.7', 6" Tam S25E 20.4'. [3-Sec. 20] North 1/16 corner between 19-20. Corner not established in the original survey. Found no subsequent record.

## B. Description of corner evidence found and/or method applied in restoring or reestablishing corner.

(AB) Recovered a 7° truncated right rectangular pyramid shaped concrete monument with a 3° square brass tablet affixed to it's top which is stamped: "Misconsin Michigan Power Company 42-31-32, 1/4 cor 24/19". The monument was recovered at record bearing and distance from the 1947 mitnesses: The tamarack is now dead and down, and the balsam has been reduced to a mossy mound. Recovered the probable remains of the original spruce BT, now a mossy mound, at record bearing and distance. Accepted the monument as a careful and faithful perpetuation of the position of the original corner.

[3-Sec. 20] found no evidence of prior monumentation at the corner position. Established the corner on a straight line between 1/4 corner 1317.89' south and section corner 1317.89' north. At the position for the corner, I placed a 1"I.O.x32" iron pipe capped with a 4" dia. cast aluminum MDMR tablet, appropriately stamped.

Description of monument for corner and accessories established to perpetuate locating the position of the corner.

(AB) Found MMPCO concrete monument.

(3) Set 1" pipe with MONR aluminum cap.

Blazed and scribed the following bearing trees:

Blazed and scribed the following bearing trees:

"1/4S NBT" 5" Spruce N85E 39.1" "1/4S NBT" 12 Cedar S64E 29.9' 6" Spruce S52# 30.3" "1/45 NBT" 16" Cedar N17N to notch, 22.3' do

Placed a 3" cedar post adjacent.

Bearings are magnetic.

4" Balsan N15E 9.7' "1/165 BT" 8" Jack Pine S4LE 10.2" 1/165 BT 7" Jack Pine SOLN 12.7" "1/16S BT" 10" Jack Pine M36W 40.1"

"1/16S BT" Placed a 4" squared maple post adjacent.

SURVEYOR Bearings are magnetic.

33786 Surveyor's Michigan License No.

For the Michigan Department of Natural Resources - Forest Management Division

SZYSZKOSKI

LAND