LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in Iran		
(County)	Located in:	Corner Code #
(000)/	40# -	- TIM 00
1. Public Land Survey	Ţ <u>42N</u> F Ţ <u> </u>	
2. Property Controlling	S 20 T 42N F	R
in Section	s FF	-
3. Miscellaneous	s TF	<u> </u>
Property in Sec.	S TF	<u> </u>


Register of Deeds Stamp & File Number

_ , Recorded Plat 4. Lot No. 5. Private Claims

Aug 12 1996 C9 Aug 13 1996

Stephan J. Szyszkoski do hereby state that under , in a field survey on 19 requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

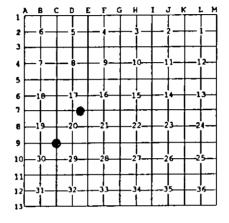

Description of original monument and accessories and/or subsequent restoration:

(C9) Corner common to Sections 19-20-29-30. Corner established in 1849 by John Burt. 80.00 Set Cedar post corner of Sections 19,20,29,30. Cedar 14 S66W 22, do 18 W38E 24". Records of Wisconsin Michigan Power Company (now Misconsin Electric Power Company) in the form of a map titled PROPERTY MARKERS PAINT AND MICHIGANNE RIVERS map #G-21-GG dated 4-10-1947, shows in regard to this corner, "Original cedar post and 1 B.T. below 1285' elev. Set concrete marker 594' west of cor 19-20-29-30. 4" Poplar M80E 6.3', 3" Poplar N37E 14.5', 3' Poplar N52W 5.8'.

(2-Sec. 20) East 1/16 corner between Sections 17-20. Corner not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(C9) Original post and accessories now considered lost beneath the surface of Peavy pond. Found a 7° truncated right rectangular pyramid shaped concrete monument with a 3° square brass tablet affixed on top which is stamped to read: "Misconsin Michigan Power Company 42-31 19-20-29-30 594' east to cor.". Mone of the WMPCO witnesses were recovered. Accepted the monument as a reference to the original corner and reestablished the corner 594.00° due east (astronomic or true east) from the WMPCO monument. The position for the corner falls in Peavy Pond and was not monumented. The corner position was used to reestablish the 1/4 corner common to Sections 20-29, to verify the position of the 1/4 corner between 19-20, and to subdivide Section 20. Mitnesses below are to the reference

(2-Sec. 20). Found no evidence of prior monumentation at the corner position, established the corner on a straight line between 1/4 corner 1319.44' Mest and Section corner 1319.44' East. At the position for the corner, I placed a 1"I.D.x32" iron pipe capped with a 4° dia. cast aluminum MONR tablet, appropriately stamped.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner (c) Found MMPCO concrete reference (2) Set 1" pipe with MONR aluminum cap.

Blazed and scribed the following bearing monument.

Blazed and scribed the following bearing trees:

11" J. Pine S44N 24.4." "1/16S BT" trees: 8" Maple N45E 21.0' "RM BT" 12" Twin R. Pine S69E 62.2" "1/16S BT" "RH BT" 12" J. Pine N37E 130.7" 1/165 81 9" W. Pine N37W 34.9" 4" N. Pine N86W 74.1" 9" W. Pine \$50W 36.9' "RH RT" 1/16S BT

"RM BT" Centerline of road is 12' east. 3" Maple NOIN 13.6' Placed a 3" squared maple post adjacent. Bearings are magnetic.

Bearings are magnetic. The water's edge is 6' east, course NSOE Signed by

PARTICIPATE . -9-96

Surveyor's Michigan License No.

33986

For the Michigan Department of Natural Resources - Forest Management Division

THE OF MICH

STEPHAN J.

SZYSZKOSKI

LAND

SURVEYOR

No.

33988

LAND SU