

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>43</u> N. <u>31</u> W. <u>X.</u> S. R. <u>31</u> W.	<u>D7 & E7</u>
2. PROPERTY CONTROLLING IN SECTION <u>17</u>	T. <u>43</u> N. <u>31</u> W. <u>X.</u> S. R. <u>31</u> W.	<u>16</u>
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. _____ E. <u>W.</u> S. R. _____ W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Arthur O. Enger do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram—over) were, in a field survey on see below 19____, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

- Corner D7:** Cedar post (Not found. See B for other monuments)
 Hemlock 24 N12E 25 (Not found. " " " " accessories)
 Fir 10 S67W 10 (Not found. " " " ")
- Corner E7:** Y. Birch post (Not found See B for other monuments.)
 Cedar 8 N12W 19 (" " No subsequent accessories found.)
 Cedar 12 S41E 28 (" " " " " ")
- Corner 16:** Not established in original survey and by approximation only, subsequently.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- Corner D7:** Re-established 4/26/74 on line between Sec. Cor. S89°53'W 40.025 ch. and Sec. Cor. N89°53'E 40.026 ch. Found a 2" I.D. iron pipe S75°18'W 57.0 ft. and a 4"x4'x3' wood post N4°26'E 92.3 ft. See Liber 1 of Survey Maps, P. 10-20 for further explanation of this corner.
- Corner E7:** On 4/26/74, replaced an old down and rotted, squared 4"x4'x2' cedar post with new monument described below. See Liber 1 of Survey Maps, P. 10-20 for explanation of this corner.
- Corner 16:** Established 5/13/74 on line between Sec. Cor. N89°53'E 20.013 ch. and 1/4 cor. S89°53'W 20.013 ch. Found a 2"x2"x5' squared cedar post S5°E 18.8 ft., placed by unknown parties for an approximate corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- Corner D7:** 1" I.D. x 52" iron pipe with 4½" brass cap.
 White Birch 6 N38 W (mag.) 18.7 ft. "1/4S, NBT"
 White Pine 6 N31°E (mag.) 63.6 ft. "1/4S, NBT"
 Red Maple 5 S80°E (mag.) 35.3 ft. "1/4S, NBT"
- Corner E7:** 1" I.D. x 36" iron pipe with 3½" aluminum cap.
 Red Maple 9 N63°E (mag.) 27.0 ft. "S16, NBT"
 Ironwood 5 (1 of clump of 3) S34°E (mag.) 47.4 ft. "S21, NBT"
 Cedar 6 S37°W (mag.) 61.7 ft. "S20, NBT"
- Corner 16:** 1" I.D. x 37" iron pipe with 3½" aluminum cap.
 Cedar 7 N65°E (mag.) 18.7 ft. "1/16S, BT"
 Cedar 6 S85°E (mag.) 17.6 ft. "1/16S, BT"


SIGNED BY _____ DATE _____


SURVEYOR'S MICHIGAN REGISTRATION NO. _____ (SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY _____ DATE _____


 Arthur O. Enger
 Michigan Department of Natural Resources

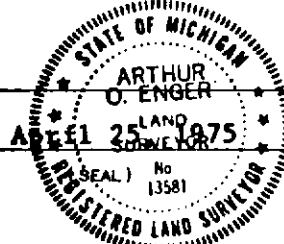

SURVEYOR'S MICHIGAN REGISTRATION NO. 13581