

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____ T. _____	N. _____ E. _____ S., R. _____ W. _____	_____
2. PROPERTY CONTROLLING IN SECTION <u>20</u>	T. <u>43</u> N. _____ E. _____ S., R. <u>31</u> W. _____	1a, 1b, & 3
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. _____ E. _____ S., R. _____ W. _____	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Arthur O. Enger do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram—over) were, in a field survey on see below 19____, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Corner 3: Not established in original survey.
Erroneously established in 1960 by B.D. Buckler, R.L.S., who placed a 1" I.D. x 48" iron pipe at the purported corner position.

Corner 1a & 1b: Meander corners on west and east banks of Michigamme River, original channel between Sec. 17 & 20. Collapse of the river bed in the Mansfield Mine cave-in in 1893 obliterated all trace of these corners.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

Corner 3: Re-established 5/9/74 on line between 1/4 cor. S1°11'W 20.033 chains and Sec. Cor. N1°11'E 20.033 ch. Buckler had re-established the sec. corner in 1960, by double proportionate measurement, but as he made a mistake (See L. 1 of Survey Maps, P. 10-20 for explanation) in his measurements, this corner was re-located in 1974, resulting in a re-location of the subject corner as well. Buckler's corner was N80°20'E 15.16 ft. from this point.

Corner 1a: Established 5/2/74 on west bank of original channel of river on true sec. line, 908.8 ft. East of Sec. Cor. and 1732.7 ft. West of 1/4 corner, and marked "AUX. M.C."

Corner 1b: Established 5/9/74 on east bank of original channel of river on true sec. line, 1293.5 ft. East of Sec. Cor. and 1348.0 ft. West of 1/4 corner, and marked "Aux. M.C."

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner 3: 1" I.D. x 40" iron pipe with 3½" aluminum cap.
Cedar 6 S19°W (mag.) 6,7 ft. "1/16S, BT"
Cedar 12 N 7°W (mag.) 47.2 ft. "1/16S, BT"
Also squared & scribed an 8" cedar N44°W 1.4 ft. (to center of tree).

Corner 1a: 1" I.D. x 36" iron pipe with 3½" aluminum cap.
Cedar 7 N30°E (mag.) 43.1 ft. "AMC, BT"
W. Birch 7 S13°E (mag.) 67.6 ft. "AMC, BT"

Corner 1b: 1" I.D. x 36" iron pipe with 3½" aluminum cap.
Cedar 6 N73°E (mag.) 79.4 ft. "BT"
Cedar 6 S64°E (mag.) 72.9 ft. "BT"

SIGNED BY _____ DATE _____


SURVEYOR'S MICHIGAN REGISTRATION NO. _____ (SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY Arthur O. Enger DATE April 25, 1975

MICHIGAN REGISTERED LAND SURVEYOR
Arthur O. Enger
Michigan Department of Natural Resources

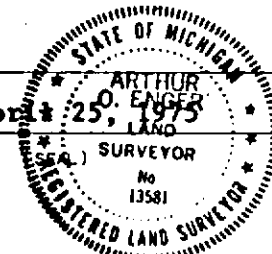

SURVEYOR'S MICHIGAN REGISTRATION NO. 13581