LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

Fo	r corners in	, , , , , , , , , , , , , , , , , , , ,			
I FON (County)		Located In:	Corner Code ≠#		
1.	Public Land Survey	T <u> 43N R _ 31N</u> T <u>43N R _ 31N</u>	C3		
		T R			
2.	Property Controlling	s T R			

Register of Deeds Stamp & File Number

. Recorded Plat


3. Miscellaneous

Property in Sec.

5. Private Claims

1. _Stephan J _ Szyczkoski . In a field survey on _ . february 23, 1993 , 19 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3,4 and 5above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law: established, re-established, monumented, re-monumented, recovered, found as expressed below

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

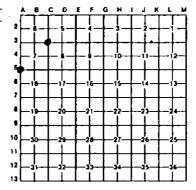

A. Description of original monument and accessories and/or subsequent restoration:

(C3) Section corner common to sections 5-6-7-8. Corner previously recorded by Arthur D. Enger in 1976 as monumented by a Concrete monument with MMPC brass marker and the following MBTs: Tamarack 15 M49M (mag.) 90.9' "56, MBT", Tamarack 20 M56E (mag.) 87.7' "55, MBT", MMPC Power pole BM61-2160 MI4 1/2M (mag.) 52.06' to tack with 3/4" brass washer stamped "MITMESS MARK". Found no subsequent record.

(AS) Section corner common to Sections 7-18, T43M-R31M, and Sections 12-13, T43M-R32M. Corner previously recorded by Dean C. DelaMater in 1953 as monumented by a 1° pipe with a 4° brass cap and mitnessed by the following NBTs: 6° Cedar East 64 links, 6° Cedar M25E 14 links. Found no subsequent record.

B Description of corner evidence found and/or method applied in restoring or reestablishing corner;

(CS) found Enger's tamarack MBTs and the stub of a sawed-off power pole all in proper relation to each other. The monument itself was not recovered. Old blazes on the tamaracks are visible and they are both still alive. The power pole appears to have been cut off below the level of the tack and washer, as these were not found. Placed a new monument, a 1'x32' iron pipe capped with a 4' dia. cast aluminum MDNR tablet at record bearing and distance from the mitnesses described above, and marked two new bearing trees as described

(AS) Found a 1° pipe with a 4° brass Michigan Dept. of Conservation cap substantially in accord with the record MBFs as follows: Cedar MBT M25E 9.2' found at record bearing and distance with old blaze but no scribing, Cedar MBT found S80E, 42.4' (rather than East) with old blaze, no scribing. Marked two new mitnesses to the monument as described below.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(C3) Set 1" pipe with a 4" MDNR cap.

(A5) Found I pipe with 4 brass cap. New mitnesses are as follows:

Marked the following new bearing treas:

6" Spruce N85E 100.0" "\$5 N8T" 8" Balsam N30N 81.9" "\$6 NBT"

7" Cedar M80N 14.8' "S12 NBT" Power pole S1N 41.37" Set mail and brass tag stamped "MONR reference

point.

Signed by Stephen 1 4	0 11.		
Signed by Stephen	worksti.	Date <u>3-23-93</u>	
, ,	33986		