

61.

**LAND CORNER RECORDATION CERTIFICATE**  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Iron	Located in:	Corner Code #
(County)		
1. Public Land Survey	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
2. Property Controlling In Section	S ___ T 44N R 31W	10
	S ___ T 44N R 31W	3
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

Jul 29 1997

I, Stephan J. Szyszkoski, in a field survey on \_\_\_\_\_, 19\_\_\_\_ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

A. Description of original monument and accessories and/or subsequent restoration:  
(10-Sec. 1) South 1/16 between Sections 1-2. Corner not established in the original survey. Found no subsequent record.  
(3-Sec. 1) North 1/16 corner between Sections 1-2. Corner not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(10-Sec. 1) Found no evidence of prior monumentation at the corner position. Established the corner midway and on a line of mean true bearing between quarter corner 1325.92' North and Section corner 1325.92' South. At the position for the corner I placed a 1" I.D. x 32" iron pipe capped with a yellow plastic cap stamped MICH D.N.R. P.S. 33986. Corner placed and witnessed by D.Lampela and B.Wheeler, Baraga District Office, MDNR.

(3-Sec. 1) Established the corner on a line of mean true bearing between quarter corner 1324.53' south and Section corner 1350.36' north. This position is 20 chains, proportionate to the original record, north of the Quarter corner. At the position for the corner, I placed a 1" I.D. x 32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. From the corner, I found a 5/8" rebar with a plastic cap #12027 (Robert Perkins) S12E 2.90 feet distant. Corner placed and witnessed by D.Lampela and B.Wheeler, Baraga District Office, MDNR.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(10) Set 1" pipe with plastic cap.

Blazed and scribed the following:

28" W. Pine N10E 23.1' 1/16S 8T

3" Aspen S01W 72.1' 1/16S 8T

20" W. Pine S27W 99.8' 1/16S 8T

4" Spruce N21W 81.2' 1/16S 8T

Placed a squared spruce post adjacent.

Bearings are magnetic.

(3) Set 1" pipe with 4" MDNR cap.

Blazed and scribed the following:

5" W. Spruce N54E 23.6' 1/16S 8T


4" W. Spruce S48E 9.7' 1/16S 8T

3" W. Spruce N83W 11.3' 1/16S 8T

6" W. Spruce N14W 3.5' 1/16S 8T

Placed a squared tan'k post adjacent.

Bearings are magnetic.

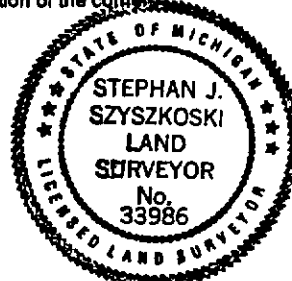

Signed by

*Stephan J. Szyszkoski*

Surveyor's Michigan License No.

33986

Date

Sept. 8, 1997

For the Michigan Department of Natural Resources - Forest Management Division