

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Iron	Located in:	Corner Code #
(County)		
1. Public Land Survey	T 44N R 31W	M8
	T R	
	T R	
	T R	
2. Property Controlling in Section	S 24 T 44N R 31W	4
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	

Register of Deeds Stamp &amp; File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

M8 Jun 25 1997  
4 Jul 31 1997

I, Stephan J. Szyszkoski, in a field survey on \_\_\_\_\_, 19\_\_\_\_ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	16	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

A. Description of original monument and accessories and/or subsequent restoration:  
(M8) Quarter corner common to Section 24 T44N-R31W and Section 19 T44N-R30W. Corner reestablished in 1969 by A.D. Enger, RLS: "Corner re-established on line between re-established section corners 39.945 ch. to N and to S. Corner monument: 1" I.D. x 36" iron pipe with 4" aluminum cap. Witnesses to corner: Sugar Maple 9 N8.5W 12.5 links, Elm 7 N49E 34 links".  
(4-Sec. 24) Northwest 1/16 corner, Section 24. Corner not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner.


(M8) Found the 1969 monument as described, a 1" iron pipe capped with a 4" cast aluminum MDNR tablet, in good condition, and at record bearing and distance from the 1969 witnesses. The Sugar is in good condition, the Elm is dead and down. My measurements to adjacent section corners are 2633.00' North and 2635.69' South. I accepted the monument as a careful and faithful reestablishment of the position of the original corner. Left the monument in place and marked three new witnesses as described below. Corner witnessed by B. Wheeler and D. Lampela, Baraga District Office, MDNR.

(4-Sec. 24) Found no evidence of prior monumentation at the corner position. Established the corner at the intersection of straight lines connecting opposite 1/16 corners. The 1/16 corners North (1317.01'), West (1321.51') and South (1317.06') are monumented. The 1/16 corner to the East was not monumented on this survey. At the position for the NW 1/16 corner, I placed a 1" I.D. x 32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. An east-west blue paint line is about 50 ft. north of the corner. Corner placed and witnessed by B. Wheeler and D. Lampela, Baraga District Office, MDNR.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner.

(M8) Found 1" pipe with 4" MDNR cap.  
Blazed and scribed the following:  
16" Sugar S49W 47.1' 1/4S NBT  
8" Sugar N15E 16.3' 1/4S NBT  
10" Sugar S66E 29.3' 1/4S NBT  
The 1969 witness: Sugar Maple N09W 8.5'  
Placed a squared post adjacent.  
Bearings are magnetic.

(4) Set 1" pipe with 4" MDNR cap.  
Blazed and scribed the following:  
8" Maple N02E 10.0' 1/16S BT  
15" Spruce N52E 33.7' 1/16S BT  
12" Spruce S84E 39.9' 1/16S BT  
9" Maple S16W 19.6' 1/16S BT  
Placed a squared maple post adjacent.  
Bearings are magnetic.

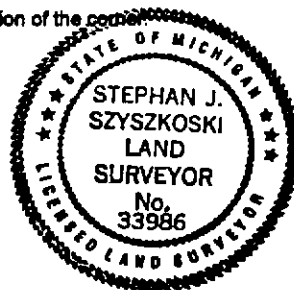

Signed by Stephan J. Szyszkoski  
Surveyor's Michigan License No. 33986

Date Sept. 8, 1997

For the Michigan Department of Natural Resources - Forest Management Division