

66.

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Iron	Located in:	Corner Code #
(County)		
1. Public Land Survey	T 44N R 31W	N7
	T _____	_____
	T _____	_____
	T _____	_____
2. Property Controlling In Section	S _____	T _____
	S _____	T _____
3. Miscellaneous Property in Sec.	S _____	T _____
	S _____	T _____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Jun 25 1997

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												


A. Description of original monument and accessories and/or subsequent restoration:
 (N7) Corner common to Sections 13-24 T44N-R31W and Sections 18-19 T44N-R30W. Corner reestablished in 1969 by A.D.Enger, RLS: "Corner re-established on line between an original section corner 159.78 ch. S and a re-established section corner 79.89 ch. N. Corner is on a west facing slope of a high, narrow N & S ridge, just below the crest. Corner monument: 1" I.D.x 36" iron pipe with 4" aluminum cap. Witnesses to corner: Red Maple 6 S401/2E 40 links, Red Maple 6 N771/2E 72 links".

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(N7) Recovered the 1969 monument as described, a 1" I.D. iron pipe capped with a 4" dia. cast aluminum MDNR tablet, in good condition, and at record bearing and distance from the remaining 1969 NBT, the Red Maple NE. The other maple NBT was apparently removed during construction of a N-S road, the centerline of which is about 12' east of the corner. My measurements to the corners noted above are 159.63 ch. South and 79.89 ch. North. I accepted the monument as a careful and faithful reestablishment of the position of the original corner. Left the monument in place and marked 3 new witnesses as described below. There is a gate on the above mentioned road whose westerly gate post is 8' east and 3' south of the monument. Corner re-witnessed by D.Lampela and B.Wheeler, Baraga District Office, MDNR.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(N7) Found 1" pipe with 4" MDNR cap.
 Blazed and scribed the following:
 15" Spruce S23W 70.9'(slope) "S24 NBT"
 18" Spruce N51W 47.1'(slope) "S13 NBT"
 3" Ironwood N15E 19.4'(Horiz) "S18 NBT"
 The 1969 wit: Red Maple 9" in clump of 3, N80E 72 links. Placed a squared sugar post adjacent. Bearings are magnetic.

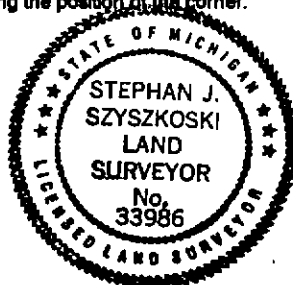

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date Sept 8, 1997

For the Michigan Department of Natural Resources - Forest Management Division