LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

[ron	Located In:	Corner Code #	
(County)			
1. Public Land Survey	7 T F T F T F		
Property Controlling in Section Miscellaneous Property in Sec.	S_11 T_44N R S_26 T_44N R S T R S T R	3111	


Register of Deeds Stamp & File Number

_, Recorded Plat 4. Lot No. 5. Private Claims

> Jul 22 1997 Sep 22 1997

Stephan J. Szyszkoski _, 19 _, in a field survey on do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

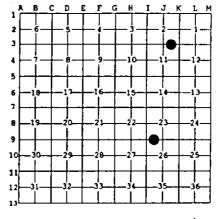

A. Description of original monument and accessories and/or subsequent restoration:
(2-Sec. 11) East 1/16 corner between sections 2-11. Corner not established in the original survey. Ewart Muller, P.S., Iron Mountain related to me that May 1954 notes of his father, Emart Muller, show that he found post at this corner, probably set by Rudy Johnson, a local timber cruiser. Found no other record.

(1-Sec. 26) West 1/16 corner between Sections 23-26. Corner not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(2-Sec. 11) Found no evidence of prior monumentation. The various calls in Muller's 1954 notes could not be made to fit with the conditions as I found them on the ground and so I did not use these notes to reestablish any corners. Established the corner midway and on a straight line between quarter corner 1317.81 feet west and section corner 1317.81 feet east. At the position for the corner, I placed a t I.O.x32 iron pipe capped with a 4 dia. cast aluminum MDMR tablet, appropriately stamped. Corner placed and witnessed by O.Lampela and B.Wheeler

(I-Sec. 26) Recovered a 1" dia. iron pipe, set firm and in good condition. Distances east and west to adjacent monumented corners was found to be 1318.95' and 1319.06' respectively. The pipe was found 0.3' morth of a straight line between them. Accepted same as a careful and faithful determination of the position of the corner. teft the monument in place and marked new witnesses as described below. Corner rewitnessed by B.Mheeler and D.Lampela, Baraga District Office, MDMR.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner (2) Set 1" iron pipe with 4" MDNR cap. (1) Found 1" dia. iron pipe.

(2) Set 1" iron pipe with 4" MDNR cap. Blazed and scribed the following: 5" 8. Spruce N58E 24.5" 1/16S BT "1/16S BT" 20" N. Pine S68E 79.7' 9" 8. Spruce \$04M 81.8" "1/16S BT" 5" B. Spruce \$46M 65.5" "1/16S BT" Placed a squared spruce post adjacent.

Blazed and scribed the following: 6" Maple clump N77E 5.7' 1/165 87 "1/16S 8T" 10" W. Pine H11E 28.9' 8" Maple \$23M 21.9' "1/16S BT" 10" W. Pine M49W 29.9'(slope) do Placed a squared maple post adjacent. Bearings are magnetic.



33986

11-18-97 Date

Surveyor's Michigan License No

Bearings are magnetic